MACRO SENSORS™
Division Of Howard A. Schaevitz Technologies, Inc.

USER MANUAL

DMC-A2 Series

Dual LVDT Controllers

- **1/8 DIN Case**
- **3-button Front Panel Operation**
- **6-digit, 0.56" (14.2 mm) Alphanumeric Display**
- **Intuitive Scrolling Text Configuration Menus**

Optimize performance and linearity
Select the correct frequency for your sensor

Introduction

The DMC-A2 Series are accurate, high performance, programmable dual channel controllers that deliver precise measurement and control for applications using LVDT (Linear Variable Differential Transformer) inputs.

The 6-digit alphanumeric LED display provides easy to follow setup prompts for all LVDT parameters using the following intuitive scrolling text configuration menus.

Input setup mode

- 50 or 60 Hz supply frequency.
- Excitation frequencies:

  50 Hz: 1.2, 1.6, 2.4, 3.2, 4.8, 6.4, 8.0, 9.6 kHz excitation.

  60 Hz: 1.44, 1.92, 2.88, 3.84, 5.76, 7.68, 9.60, 11.52 kHz excitation.
- Update rates: 1, 4, 10, or 20 readings per second.
- Independent decimal point position setting for each channel display with resolution to 0.00001 of any engineering unit.

Calibration mode

- Independent calibration for each channel:

  Auto Calibration: 2-point zero and span setting.

  Offset Trim: Independently trim the zero setting or enter an offset value.

  Span Trim: Independently trim the span setting.

Analog output mode

- Zero setting.
- Full scale setting.

Setpoints mode

- Four independently configured setpoints with above and below setpoint value actuation.

Options

- **Relays**

  Standard: Four 5 amp relays.
- **Analog Output**

  Standard: Fully scalable from 0/4 to 20 mA (or reverse).

  Options: Single 0 to 10 V DC (or reverse) or dual 0 to 10 V DC.

Advanced Functions

A range of built-in measurement and control functions are available with the DMC-A2 Series controllers' resident operating system that can also be programmed from the front panel. These include:

- **Linearization**. Up to four 32-point flexible linearization tables or a single 125-point flexible table.
- **Serial Communications.** Optional single ASCII or Ethernet (TCP/IP) outputs.
- **Differential Measurement**. Differential measurement and cross channel maths available (A+B, A–B, AxB, A/B).

Specifications

General

Digital Display: 14-segment alphanumeric, 0.56" (14.2 mm) LEDs.

Display Color: Red (standard). Green or Super-bright Red (optional).

Display Range: -199999 to 999999.

Display Update Rate: 1, 4, 10, or 20 times per second.

Display Dimming: 8 brightness levels. Front panel selectable.

Scrolling Display Text Messaging: Full alphanumeric text characters supported.

Polarity: Assumed positive. Displays – negative.

Annunciators: 6 red LEDs on front panel; one per setpoint.

Overrange Indication: OVER

Underrange Indication: UNDER

Front Panel Controls: PROGRAM, UP and DOWN buttons.

Power Supplies. Standard high voltage AC / DC power supply 85-265 V AC / 95-370 V DC, or optional low voltage AC / DC power supply 18-48 V AC / 10-72 V DC.

Environmental

Operating Temperature: 0 to 50 ÞC (32 ÞF to 122 ÞF).

Storage Temperature: -20 ÞC to 70 ÞC (-4 ÞF to 158 ÞF).

Relative Humidity: 95% (non-condensing) at 40 ÞC (104 ÞF).

Mechanical

Case Dimensions: 1/8 DIN, 96x48 mm (3.78" x 1.89").

Case Depth: 137 mm maximum (5.39").

Case Material: 94V-0 UL rated self-extinguishing polycarbonate.

Weight: 11.5 oz (0.79 lbs), 14 oz (0.96 lbs) when packed.

Approvals

CE: As per EN-61000-3/4/6 and EN-61010-1.

Input Module ISL1

Excitation Voltage: 3 V RMS sine wave, zero DC component THD <2% (1.2 kHz).

Excitation Frequency: x 16 selectable frequencies available (1.2 kHz to 11.5 kHz). Crystal locked, software driven.

Temperature Coefficient: ± 50 ppm/ ° C of full scale (typical).

Dual LVDT Inputs: 30 k input impedance. Synchronous demodulation of excitation carrier. >130 db rejection of excitation carrier.

Frequency Response: 500 Hz (–3 db) low-pass filter.

Analog to Digital: Dual channel ΣΔ A/D convertor approaching 19-bit resolution. Ratiometric operation relative to excitation voltage magnitude.

Dual Output Rates: Rapid and average response outputs. 1 Hz, 2 Hz, 10 Hz, 20 Hz averaged.

Line Frequency Rejection: 50 / 60 Hz noise rejection.

Relay Output Modules

Plug into carrier board from rear:

Four Relay Module: Available with four 5 A Form A Relays*.

***Form A Relay Specifications:** 5 A 240 VAC, 4 A 24 VDC. Isolation 3000 V. UL and CSA listed.

Table of Contents

Specifications 1
Introduction 1
Intuitive Scrolling Text Menus 2
View Modes 2
Configuration Menus Logic Tree 2
Input Setup 3
Calibration Mode 4
Calibration Mode Zero Options 5
Analog Output Scaling Mode 5
Setpoints 7
Input Signal Setup Procedures 8
Connector Pinouts 9
Installation 11
Analog Output Scaling Example 12
Analog Output Signal Calibration Example 13
Application Examples 14
Serial Communications 15
Notes 26

Intuitive Scrolling Text Menus

After the controller has been powered up, the display settles and indicates the input signal calibrated value. This is known as the operational mode and is generally referred to as the **operational display** throughout this document.

Intuitive scrolling text menus provide quick access to a range of configuration modes for easy LVDT sensor application setup. The **Configuration Menus Logic Tree** below describes the configuration menus.

View Modes

The view modes allow easy viewing of the second channel reading plus total 1 and total 2 if required.

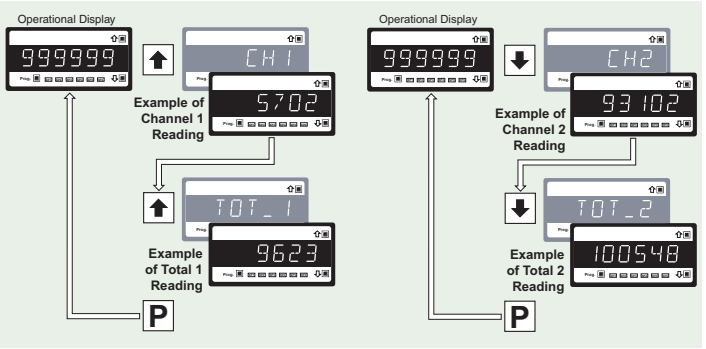

Configuration Menus Logic Tree

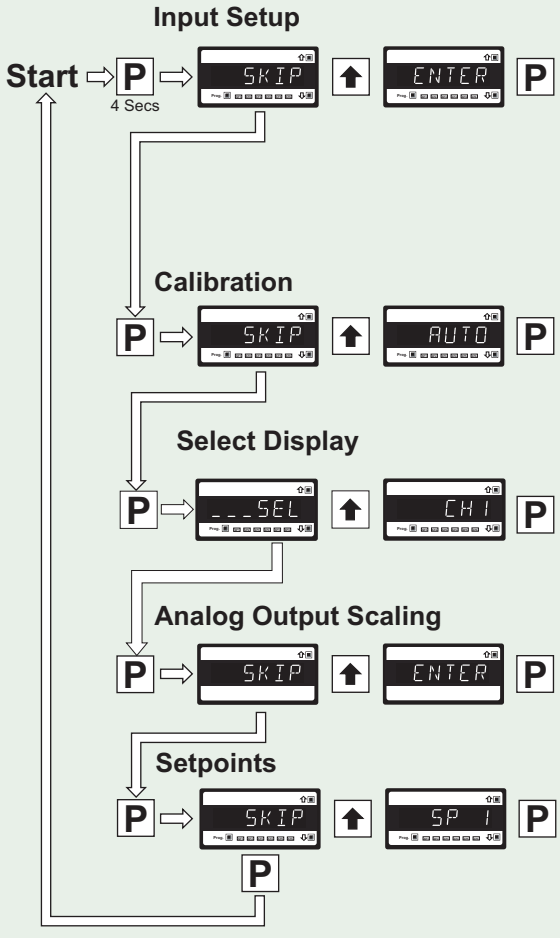

Takes you into Input Setup mode and provides selection for:
- Supply frequency: 50 or 60 Hz.
- One of eight excitation settings for either 50 or 60 Hz.
- One of four output rates.
- Independent decimal point position for channels 1 and 2.

See Page 3

Takes you into Calibration mode and provides selection for:
- Either channel 1 or channel 2 for calibration.
- 2-point auto calibration for zero and span.
- Manual trim for zero offset.
- Manual trim for span.

See Page 4

Allows you to change the displayed value:
- Select either CH1, CH2, CH1+CH2 or CH1-CH2.

See Page 4

Takes you into Analog Output Scaling mode and provides:
A menu that allows you to set zero and full scale analog output calibration settings.

See Page 5

Takes you into Setpoint mode and provides:
- Selection of individual setpoints SP1 to SP4.
- Setting of individual setpoint source.
- Setting of individual setpoint activation value.
- Setting of individual setpoint activation ABOVE or BELOW.

See Page 6

Input Setup

The **input setup** mode allows you to configure five input setup settings in linked menus.

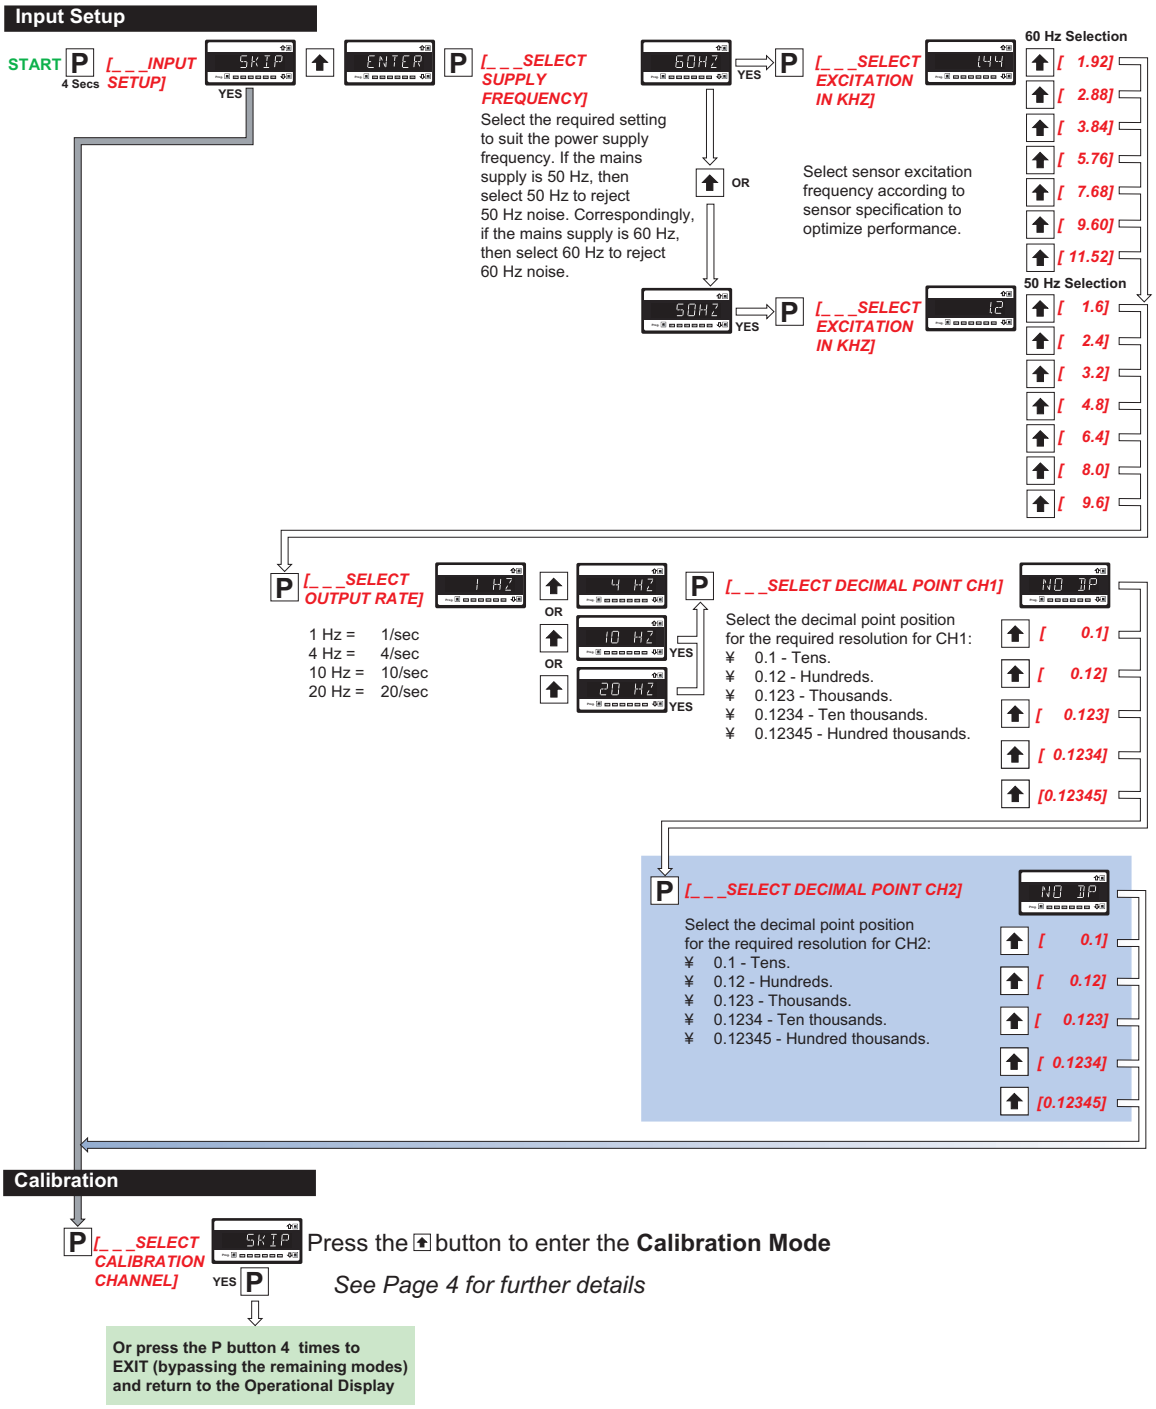
Input Setup
START
4 Secs
[_ _ _INPUT SETUP]
SKIP
YES
ENTER
[_ _ _SELECT SUPPLY FREQUENCY]
Select the required setting to suit the power supply frequency. If the mains supply is 50 Hz, then select 50 Hz to reject 50 Hz noise. Correspondingly, if the mains supply is 60 Hz, then select 60 Hz to reject 60 Hz noise.
60HZ
50HZ
OR
[_ _ _SELECT EXCITATION IN KHZ]
Select sensor excitation frequency according to sensor specification to optimize performance.
60 Hz Selection
[1.92]
[2.88]
[3.84]
[5.76]
[7.68]
[9.60]
[11.52]
50 Hz Selection
[1.6]
[2.4]
[3.2]
[4.8]
[6.4]
[8.0]
[9.6]
[_ _ _SELECT OUTPUT RATE]
1 Hz = 1/sec
4 Hz = 4/sec
10 Hz = 10/sec
20 Hz = 20/sec
[_ _ _SELECT DECIMAL POINT CH1]
Select the decimal point position for the required resolution for CH1:
¥ 0.1 - Tens.
¥ 0.12 - Hundreds.
¥ 0.123 - Thousands.
¥ 0.1234 - Ten thousands.
¥ 0.12345 - Hundred thousands.
NO DP
[0.1]
[0.12]
[0.123]
[0.1234]
[0.12345]
[_ _ _SELECT DECIMAL POINT CH2]
Select the decimal point position for the required resolution for CH2:
¥ 0.1 - Tens.
¥ 0.12 - Hundreds.
¥ 0.123 - Thousands.
¥ 0.1234 - Ten thousands.
¥ 0.12345 - Hundred thousands.
Calibration
[_ _ _SELECT CALIBRATION CHANNEL]
Press the button to enter the Calibration Mode
See Page 4 for further details
Or press the P button 4 times to EXIT (bypassing the remaining modes) and return to the Operational Display

Calibration Mode (Calibration of Sensor Position to Display)

The **calibration** mode is used to calibrate the physical position of the sensor to the meter display. The calibration mode provides four individual calibration techniques. These are:

- Adjusting the LVDT until the display reads zero.
- A dual position, zero and span calibration procedure.
- Independent trimming of the zero position or entry of an offset value without altering the span.
- Independent trimming of the span position or entry of an offset value without altering the zero.

Note: Calibration procedures can not be carried out on a signal (Result, CH1 or CH2) if the signal has an active linearization table. The table or tables must be disabled before calibration and then re-activated when calibration is complete

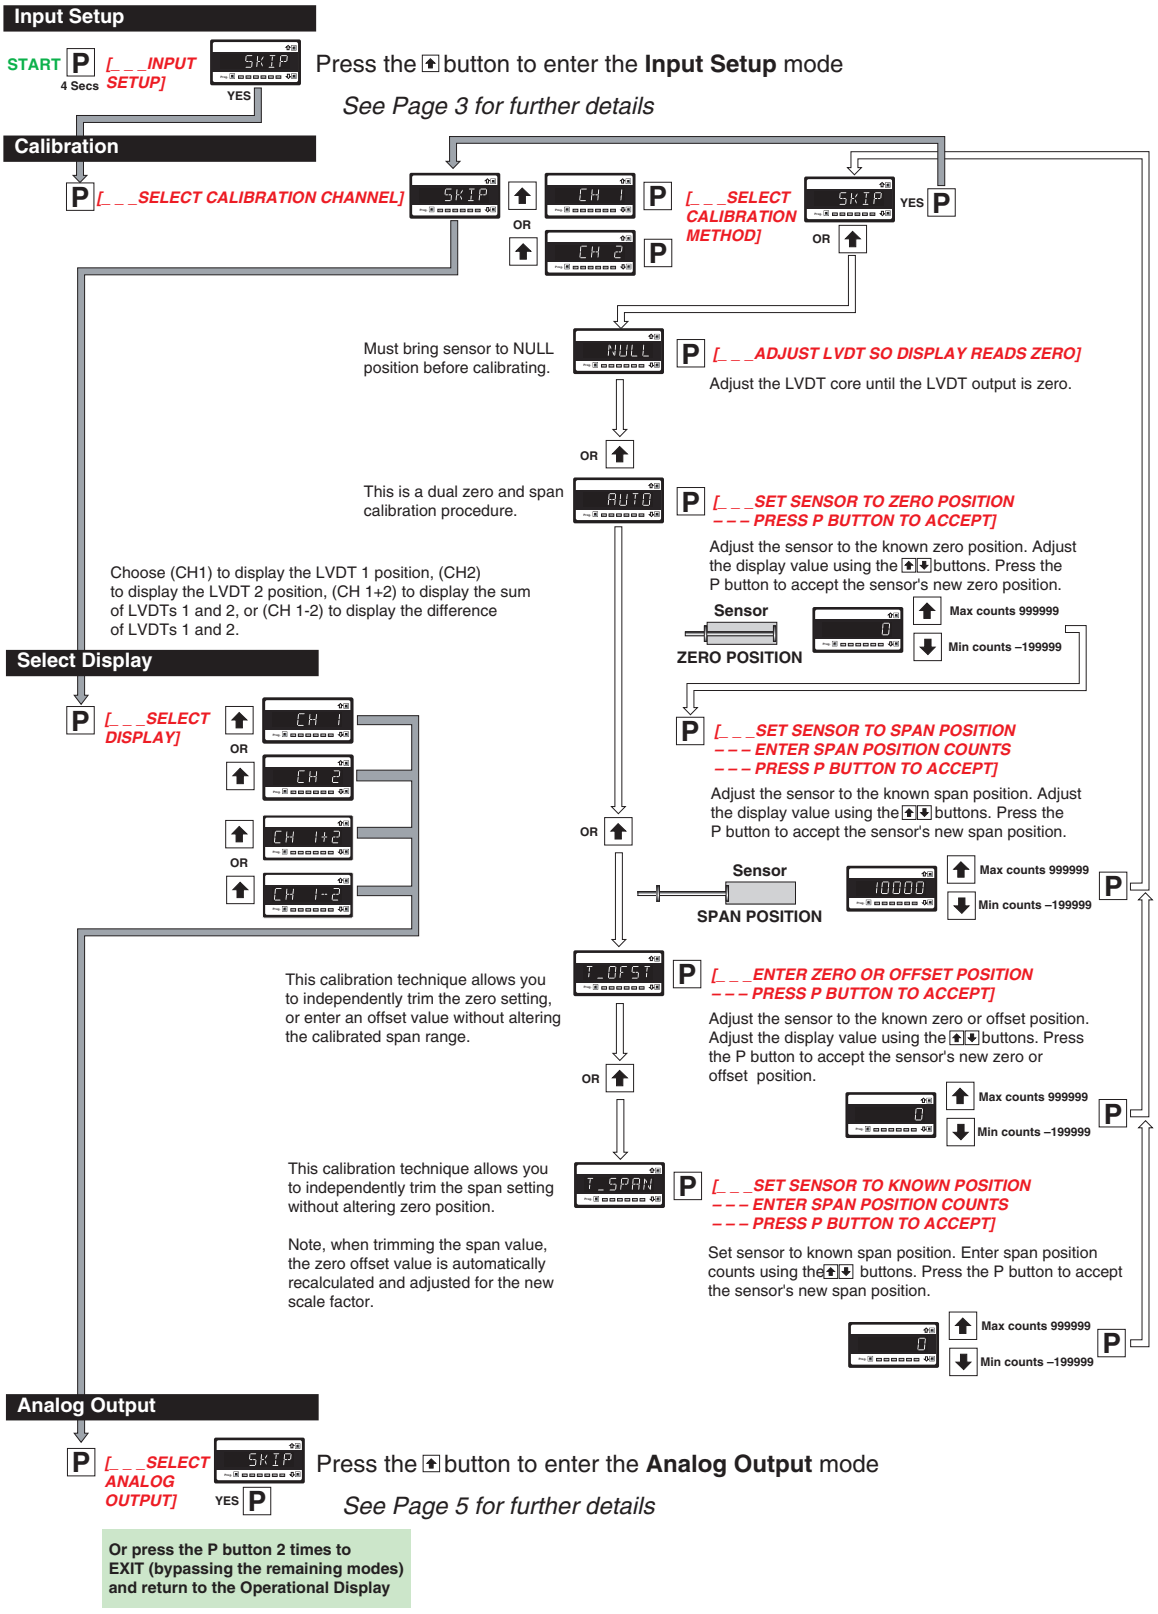
Input Setup
START
4 Secs
[_ _ _INPUT SETUP]
SKIP
YES
Press the ↑ button to enter the Input Setup mode
See Page 3 for further details
Calibration
[_ _ _SELECT CALIBRATION CHANNEL]
SKIP
CH 1
CH 2
OR
[_ _ _SELECT CALIBRATION METHOD]
SKIP
YES
OR
Must bring sensor to NULL position before calibrating.
NULL
[_ _ _ADJUST LVDT SO DISPLAY READS ZERO]
Adjust the LVDT core until the LVDT output is zero.
OR
This is a dual zero and span calibration procedure.
AUTO
[_ _ _SET SENSOR TO ZERO POSITION
– – – PRESS P BUTTON TO ACCEPT]
Adjust the sensor to the known zero position. Adjust the display value using the ↑↓ buttons. Press the P button to accept the sensor's new zero position.
Sensor
ZERO POSITION
0
Max counts 999999
Min counts –199999
Choose (CH1) to display the LVDT 1 position, (CH2) to display the LVDT 2 position, (CH 1+2) to display the sum of LVDTs 1 and 2, or (CH 1-2) to display the difference of LVDTs 1 and 2.
Select Display
[_ _ _SELECT DISPLAY]
CH 1
CH 2
CH 1+2
CH 1-2
OR
[_ _ _SET SENSOR TO SPAN POSITION
– – – ENTER SPAN POSITION COUNTS
– – – PRESS P BUTTON TO ACCEPT]
Adjust the sensor to the known span position. Adjust the display value using the ↑↓ buttons. Press the P button to accept the sensor's new span position.
OR
Sensor
SPAN POSITION
10000
Max counts 999999
Min counts –199999
This calibration technique allows you to independently trim the zero setting, or enter an offset value without altering the calibrated span range.
T_OFST
[_ _ _ENTER ZERO OR OFFSET POSITION
– – – PRESS P BUTTON TO ACCEPT]
Adjust the sensor to the known zero or offset position. Adjust the display value using the ↑↓ buttons. Press the P button to accept the sensor's new zero or offset position.
OR
0
Max counts 999999
Min counts –199999
This calibration technique allows you to independently trim the span setting without altering zero position.
Note, when trimming the span value, the zero offset value is automatically recalculated and adjusted for the new scale factor.
T_SPAN
[_ _ _SET SENSOR TO KNOWN POSITION
– – – ENTER SPAN POSITION COUNTS
– – – PRESS P BUTTON TO ACCEPT]
Set sensor to known span position. Enter span position counts using the ↑↓ buttons. Press the P button to accept the sensor's new span position.
0
Max counts 999999
Min counts –199999
Analog Output
[_ _ _SELECT ANALOG OUTPUT]
SKIP
YES
Press the ↑ button to enter the Analog Output mode
See Page 5 for further details
Or press the P button 2 times to EXIT (bypassing the remaining modes) and return to the Operational Display

Calibration Mode (cont.) Zero Options

NULL

The NULL position allows the user to adjust the LVDT core until the LVDT output is zero. The sensor must be brought to NULL position before calibrating.

Display Zero and Reset Display Value Function

The controller has been programmed with a **display zero** and **reset display value** function that operates on the selected primary display reading only.

The **display zero** function is used to zero the display. Display zero is initiated from a remote switch (not supplied) connected across the **common** and **hold** pins at the rear of the controller (Terminal 2: Pin 4 Common, Pin 2 Hold).

The **reset display value** function is used to restore the true calibrated value on the display. Reset display value is initiated from a remote switch connected across the **common** and **lock** pins at the rear of the controller (Terminal 2: Pin 4 Common, Pin 1 Lock).

The display zero value and reset display value are not retained during a power outage.

The display zero and reset display value functions are often used for cut, measure, and trim applications.

Analog Output Scaling Mode

The analog output module is a standard single channel, programmable, isolated, 16-bit analog output that can be scaled to any desired span between –199999 to 999999 display counts using the **analog output scaling mode**.

The Analog Output Scaling Mode is a two part mode that covers both scaling and calibration of the output signal. The scaling part of the procedure can be changed independently of the output calibration part and vice versa.

Scaling

Scaling requires setting the zero [ZEro] and full scale [F_SCL] span parameters of the analog output.

Zero is the display setting at which the analog output is required to be at its calibrated **low** output. Full scale is the display setting at which the analog output is required to be at its calibrated **high** output.

There are no limits to the difference between the zero and full scale settings. The difference can be anywhere between 1 count and the entire display range of the meter.

Setting the 1st and 2nd digit to 25 [CAL] [25X] accesses the **analog output signal span scaling procedure**.

By selecting a number in the 3rd digit, one of the following analog output signals are available for scaling:

- Analog Output 1 [251].
- Analog Output 2 [252].

Note: **DO NOT CHANGE THESE SETTINGS OR YOU WILL RENDER THE METER INOPERATIVE!**

A step by step procedure that shows an actual example of how to scale the analog output is shown on page 12 of this manual.

Calibration of the Analog Output Signal

Calibrating the analog output means ensuring the LOW and HIGH analog output signals are correct using a calibration device such as a multimeter. **This should not be confused with calibrating the physical position of the sensor to the meter (see page 4)!**

Calibration requires setting the [CAL_L] and [CAL_h] parameters. [CAL_L] is used to set the calibrated **low** analog output, and [CAL_h] is used to set the calibrated **high** analog output. The calibrated low and high outputs can be set anywhere between –0.3 to 21 mA for current, or –0.3 to 10.5 V for voltage.

Before calibrating the analog output:

- Select the data source for the selected analog output in Code 1.
- Connect a multimeter to the analog output connector at the rear of the meter (pin 16 positive, pin 17 negative).
- Make sure the multimeter is set to read the appropriate signal type: volts or milliamps.

Enter the calibration mode and calibrate the analog output module.

Setting the 1st and 2nd digits to [15X] selects the **analog output calibration procedure**.

By selecting a number in the 3rd digit, one of the following analog output signals are available for calibration:

- Analog Output 1 [151].
- Analog Output 2 [152].

Note: **DO NOT CHANGE THESE SETTINGS OR YOU WILL RENDER THE METER INOPERATIVE!**

A step by step procedure that shows an actual example of how to calibrate the analog output signal is shown on page 13 of this manual.

Note: Calibration procedures can not be carried out on a signal (Result, CH1 or CH2) if the signal has an active linearization table. The table or tables must be disabled before calibration and then re-activated when calibration is complete

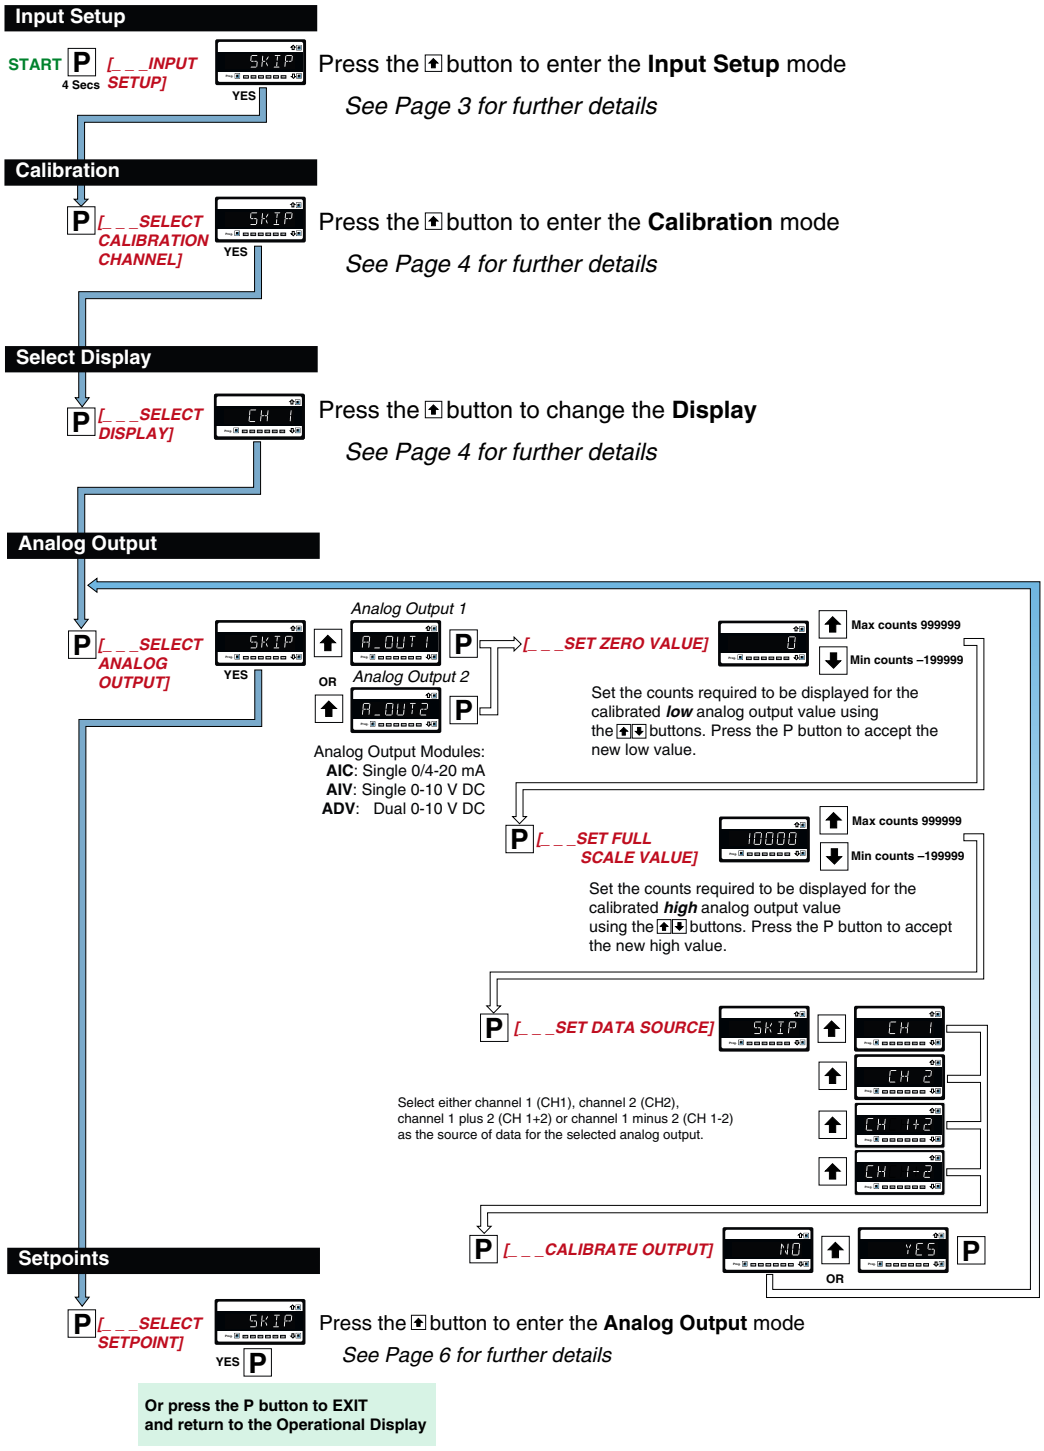
Input Setup
START
4 Secs
[_ _ _INPUT SETUP]
SKIP
YES
Press the ↑ button to enter the Input Setup mode
See Page 3 for further details
Calibration
[_ _ _SELECT CALIBRATION CHANNEL]
SKIP
YES
Press the ↑ button to enter the Calibration mode
See Page 4 for further details
Select Display
[_ _ _SELECT DISPLAY]
CH 1
Press the ↑ button to change the Display
See Page 4 for further details
Analog Output
[_ _ _SELECT ANALOG OUTPUT]
SKIP
YES
Analog Output 1
A_OUT1
OR
Analog Output 2
A_OUT2
Analog Output Modules:
AIC: Single 0/4-20 mA
AIV: Single 0-10 V DC
ADV: Dual 0-10 V DC
[_ _ _SET ZERO VALUE]
0
Max counts 999999
Min counts –199999
Set the counts required to be displayed for the calibrated low analog output value using the ↑↓ buttons. Press the P button to accept the new low value.
[_ _ _SET FULL SCALE VALUE]
10000
Max counts 999999
Min counts –199999
Set the counts required to be displayed for the calibrated high analog output value using the ↑↓ buttons. Press the P button to accept the new high value.
[_ _ _SET DATA SOURCE]
SKIP
CH 1
CH 2
CH 1+2
CH 1-2
Select either channel 1 (CH1), channel 2 (CH2), channel 1 plus 2 (CH 1+2) or channel 1 minus 2 (CH 1-2) as the source of data for the selected analog output.
[_ _ _CALIBRATE OUTPUT]
NO
YES
OR
Setpoints
[_ _ _SELECT SETPOINT]
SKIP
YES
Press the ↑ button to enter the Analog Output mode
See Page 6 for further details
Or press the P button to EXIT and return to the Operational Display

Setpoints

The **setpoint** mode provides settings for six individual setpoints.

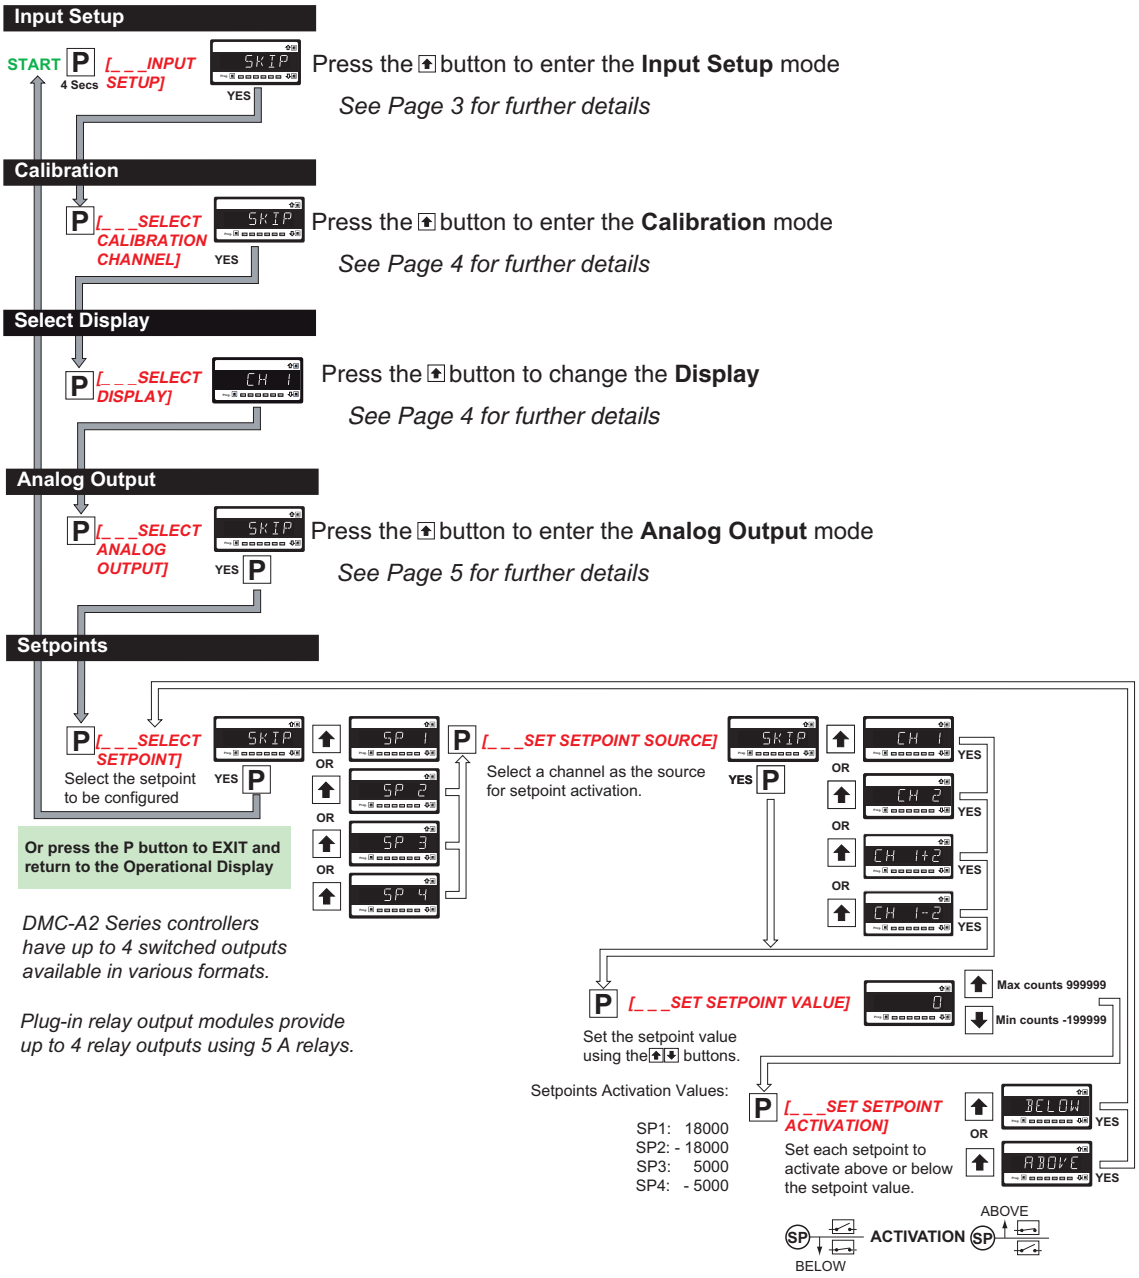

Technical Description

This input is a smart input module designed to drive and condition the signals from two LVDT transducers. The module contains two high-speed microcontrollers and a SD 16-bit dual channel A/D convertor. It communicates with the selected controller via the I²C data bus. One of the microcontrollers generates the sine wave for the LVDT excitation frequency. These frequencies are produced as multiples of the line frequency (either 50 Hz or 60 Hz). Up to 16 frequencies are available and are selected using the controller setup. The output to the primary coil of both LVDTs is a 3 V RMS sine wave. The received LVDT signals are synchronously demodulated and filtered to remove the carrier frequency. The Σ Δ 16-bit A/D convertor has over 130 dB noise rejection at the excitation frequencies and is capable of 40 Hz averaged output on 45 samples.

Two open collector NPN transistors (SP5 and SP6) are available as high-speed controlled outputs.

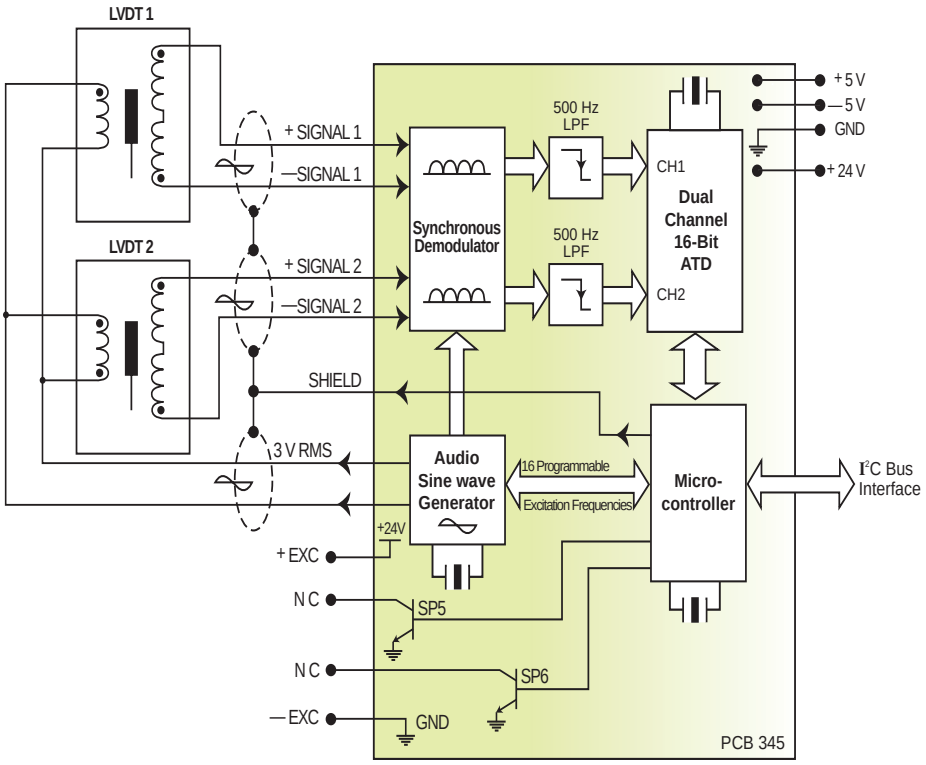

Figure 1 – LVDT Smart Input Module Functional Schematic

Example Connection Diagram

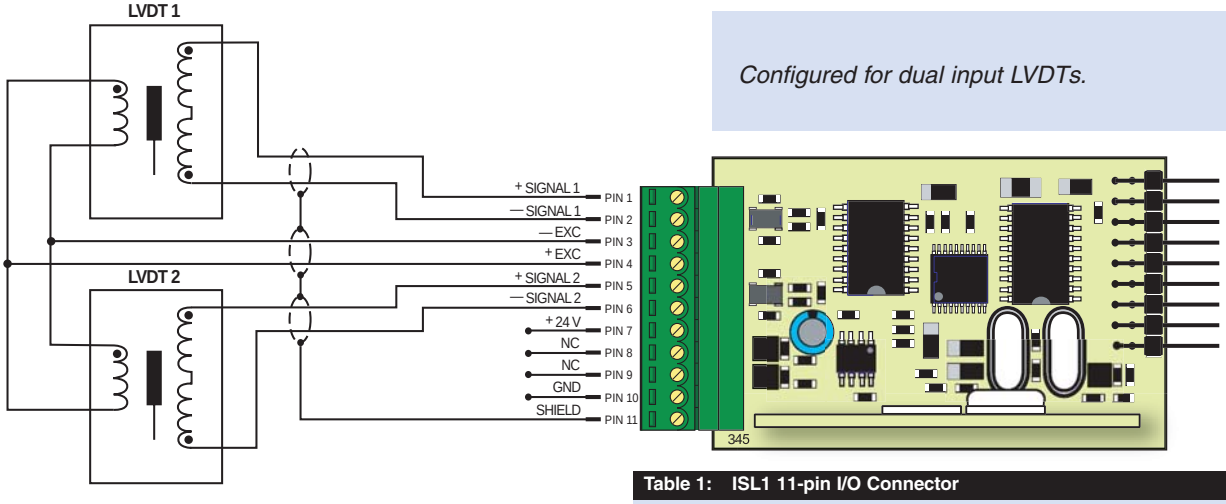

Configured for dual input LVDTs.

Table 1: ISL1 11-pin I/O Connector

Pin	Description	Function
1	+Signal 1	LVDT 1 input signal +
2	–Signal 1	LVDT 1 input signal –
3	–EXC	Dual LVDT excitation sine wave (1-11 kHz).
4	+EXC	
5	+Signal 2	LVDT 2 input signal +
6	–Signal 2	LVDT 2 input signal –
7	+24 V	Excitation voltage +24 V, 150 mA.
8	NC	Not used.
9	NC	Not used.
10	Ground	0 V.
11	Shield	Cable shield, 3 V common mode.

Figure 2 – Example Connection Configured for Dual LVDT Inputs

Connector Pinouts

All external connections to the DMC-A2 Series are via the following six connector terminal blocks located at the rear of the controller:

- Terminal 1: Input Signals.
- Terminal 2: Function Pins.
- Power: AC / DC Power Supply.
- Terminal 4: Analog Output.
- Terminal 5: Serial Output.
- Terminal 6: Relay Output.

DMC-A2 Series use plug-in type screw terminal connectors for most input and output connections, an RJ-11 phone connector for the RS-232 serial output and an RJ-45 phone connector for the optional Ethernet output.

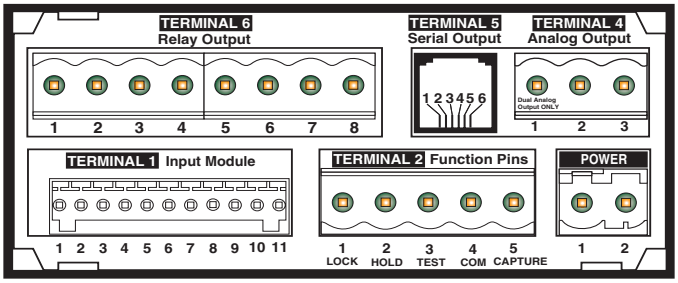

WARNING: **AC and DC input signals and power supply voltages can be hazardous. Do not connect live wires to screw terminal plugs, and do not insert, remove, or handle screw terminal plugs with live wires connected.**

Figure 3 – Rear Panel Pinout Diagram

Connector	Pin	Name	Description
TERMINAL 1 **Input Signals** Pins 1 up to 11	1 2 3 4 5 6 7 8 9 10 11	+ Signal 1 – Signal 1 –Excitation +Excitation + Signal 2 – Signal 2 + 24 V Not Used Not Used Ground Shield	**Input Module ISL1** 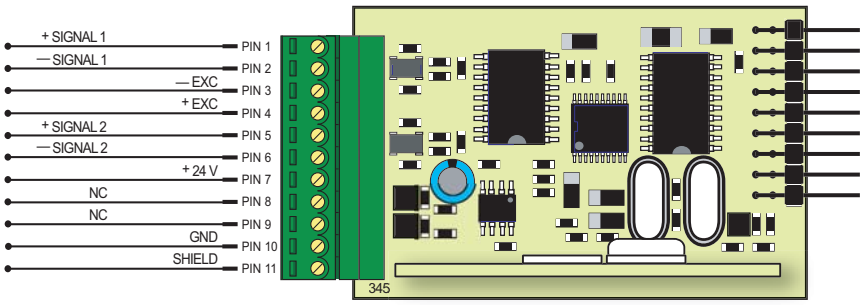
TERMINAL 2 **Function Pins** Pins 1 to 5	1	Reset Display Value (Lock)	By connecting Pin 1 (**lock**) to Pin 4 (**common**) with a remote spring-return switch restores the display to the true calibrated value.
	2	Display Zero (Hold)	By connecting Pin 2 (**hold**) to Pin 4 (**common**) with a remote spring-return switch zeroes the display.
	3	Display Test and Reset	Pin 3 (**display test** and **reset** pin) provides a test of the controller's display and resets the microprocessor when Pin 3 is connected to Pin 4.
	4	Common	To activate the **hold**, **test and reset**, or **lock** pins from the rear of the controller, the respective pins have to be connected to the **common** pin.
	5	Manual Zero (Capture)	By connecting Pin 5 (**capture**) to Pin 4 (**common**) with a remote spring-return switch manually resets the calibrated zero. **For further details on the function pins, contact Macro Sensors.**
POWER **Auto Sensing AC / DC Power Supply** Pins 1 and 2	1 2	AC Neutral / DC – AC Line / DC +	The **power** connector supplies AC / DC power to the controller via a standard high voltage or optional low voltage auto-sensing power supply mounted on the main board. **PS1**: Standard High Voltage option. 85-265 V AC / 95-370 V DC. **PS2**: Optional Low Voltage option. 14-48 V AC / 10-72 V DC.

Connector	Pin	Name	Description
TERMINAL 4 **Analog Outputs** Pins 1 to 3	TERMINAL 4 connects the analog output module to external devices. A single 0~4 to 20 mA (standard) or (optional) 0 to 10 V DC or dual 10–0–10 V DC is supported on the standard or Ethernet carrier board.		
	1	Positive (+)	Positive for Analog Output 2 (**ADV** – Dual 10–0–10 V DC modules only).
	2	Negative (–)	Negative for Analog Output 1 and 2.
	3	Positive (+)	Positive for Analog Output 1.

TERMINAL 5

Serial Outputs

Pins 1 up to 8

TERMINAL 5 connects the serial output module to external devices.

The **standard** carrier board supports a single or dual RS-232 ASCII or Modbus serial card connected thru an RJ-11 socket.

The **Ethernet** carrier board uses an RJ-45 socket at 10/100 Base-T.



	STANDARD CARRIER BOARD		ETHERNET CARRIER BOARD	
Pin No.	RS-232 (ASCII or Modbus) RJ-11 Socket		RJ-45 Socket (10/100 Base-T)	
	Single Output	Dual Output		
1	Reserved for future use	RXD1	White/Orange	TXD+
2	Isolated Ground	0 V	Orange	TXD–
3	+5 VDC to power external converters	0 V1	White/Green	RXD+
4	TXD. Transmitted Serial	TXD	Blue	–
5	RXD. Received Serial	RXD	White/Blue	–
6	Reserved for future use	TXD1	Green	RXD–
7	Not applicable	Not applicable	White/Brown	–
8	Not applicable	Not applicable	Brown	–

TERMINAL 6

Relay Outputs

Pins 1 up to 8

TERMINAL 6 connects electromechanical and solid state relays (SSRs) to external applications.

Depending on the number of relays, standard plug-in relay boards use up to 8 pins.

Relay Module

1	Normally Open SP4
2	Common SP4
3	Normally Open SP3
4	Common SP3
5	Normally Open SP2
6	Common SP2
7	Normally Open SP1
8	Common SP1

Relay Modules with Four 5 A Form A Relays

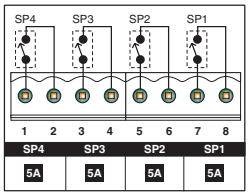

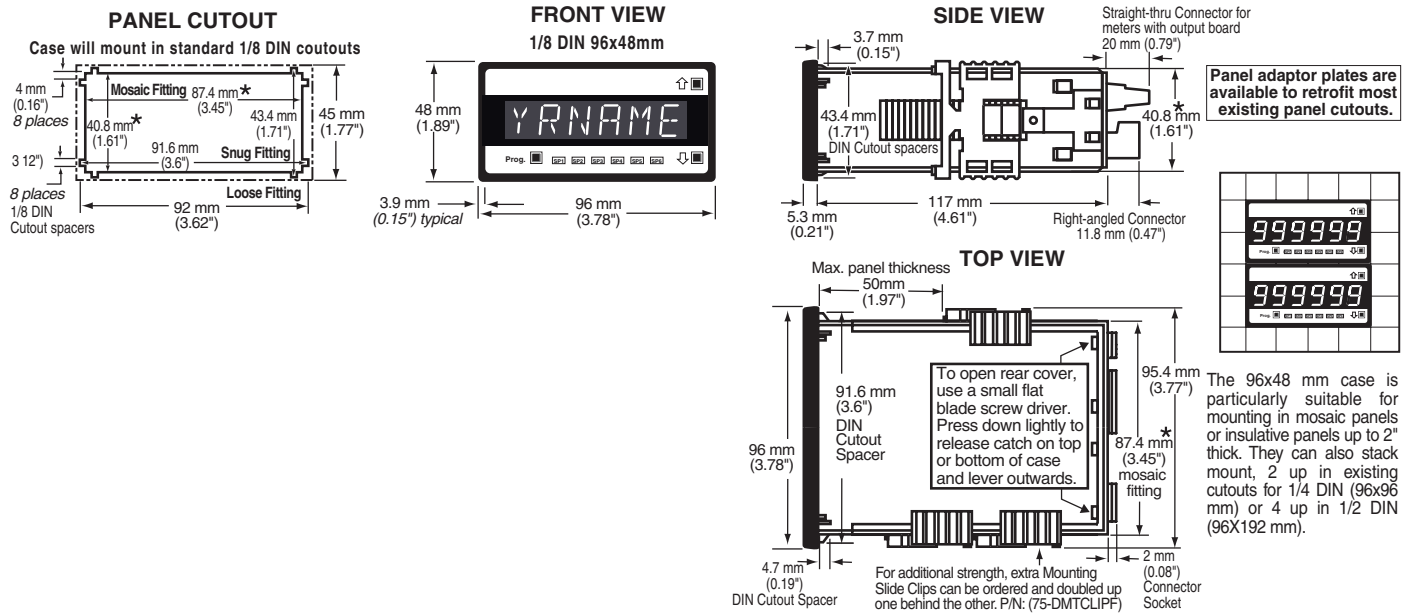
PANEL CUTOUT
Case will mount in standard 1/8 DIN coutouts
4 mm (0.16") 8 places
Mosaic Fitting
87.4 mm (3.45")
40.8 mm (1.61")
43.4 mm (1.71")
91.6 mm (3.6")
Snug Fitting
45 mm (1.77")
3 12")
8 places
1/8 DIN Cutout spacers
92 mm (3.62")
Loose Fitting
FRONT VIEW
1/8 DIN 96x48mm
48 mm (1.89")
YRNAME
Prog.
3.9 mm (0.15") typical
96 mm (3.78")
SIDE VIEW
Straight-thru Connector for meters with output board
20 mm (0.79")
3.7 mm (0.15")
43.4 mm (1.71")
DIN Cutout spacers
40.8 mm (1.61")
5.3 mm (0.21")
117 mm (4.61")
Right-angled Connector 11.8 mm (0.47")
Panel adaptor plates are available to retrofit most existing panel cutouts.
999999
TOP VIEW
Max. panel thickness 50mm (1.97")
91.6 mm (3.6") DIN Cutout Spacer
To open rear cover, use a small flat blade screw driver. Press down lightly to release catch on top or bottom of case and lever outwards.
95.4 mm (3.77")
87.4 mm (3.45") mosaic fitting
96 mm (3.78")
4.7 mm (0.19") DIN Cutout Spacer
For additional strength, extra Mounting Slide Clips can be ordered and doubled up one behind the other. P/N: (75-DMTCLIPF)
2 mm (0.08") Connector Socket

The 96x48 mm case is particularly suitable for mounting in mosaic panels or insulative panels up to 2" thick. They can also stack mount, 2 up in existing cutouts for 1/4 DIN (96x96 mm) or 4 up in 1/2 DIN (96X192 mm).

Installation Procedure

WARNING

AC and DC power supply voltages are hazardous. Make sure the power supply is isolated before connecting to the meter.

STEP A Prepare the Panel

1) Cut a hole in the panel to suit the panel cutout. See panel cutout sizes above.

STEP B Install the Meter

1) Remove both mounting clips from the meter. ①
2) Push the meter into the panel cutout from the front of the panel. ②
3) Attach both mounting clips to the meter from the rear of the panel and push them towards the front of the panel until the meter is firmly held. ③

STEP C Connect the Cables

1) Connect all input and output signal cables to the connector pins (See *Connector Pinouts* for details).
2) Connect the power cables to the connector pins (See *Connector Pinouts* for details).

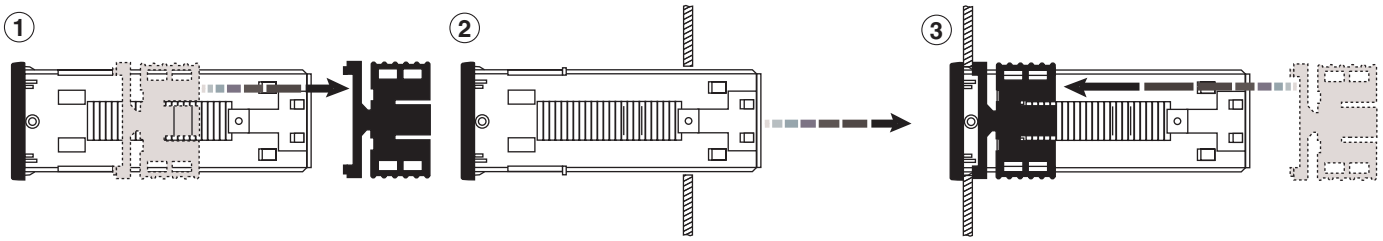

Figure 4 – DMC-A2 Series Installation Sequence

In this example the analog output signal is scaled over a range of 50 to 30,000 counts.

Scaling the Analog Output Signal

START HERE

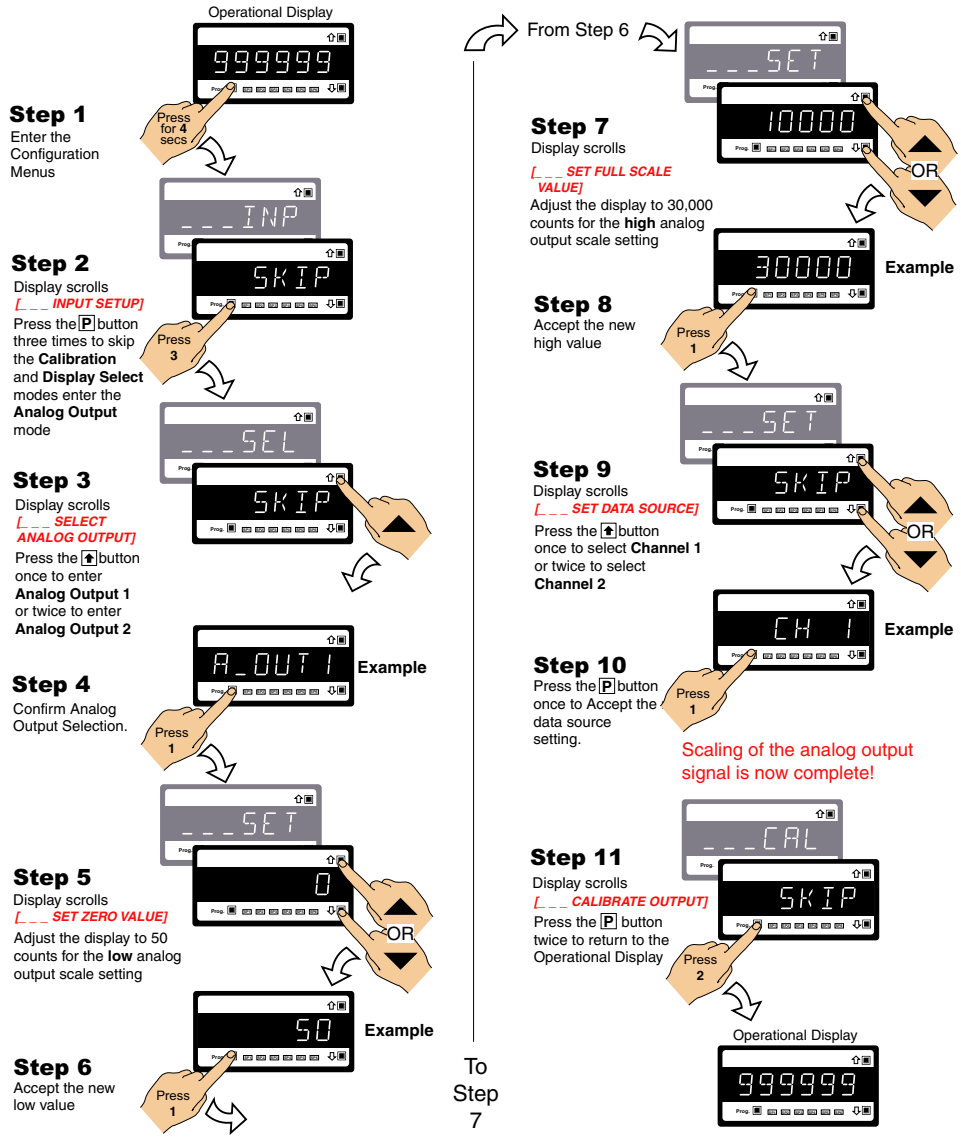

Analog Output Signal Calibration Procedure

In this example the analog output is calibrated for a 0 to 10 V DC output.

1) Connect a multimeter to the analog output connector at the rear of the meter (Terminal 4: Pin 3 positive, Pin 2 negative).
2) Make sure the multimeter is set to read the appropriate signal type: volts or milliamps.
3) Carry out the analog output scaling procedure (if necessary) to set zero and full scale settings.
4) Carry out the analog output calibration procedure to calibrate the milliamp (or voltage) output low and high settings.

Note: The analog output may be calibrated to other ranges such as 0-20 mA or 4-20 mA.

Calibration of the Analog Output Signal

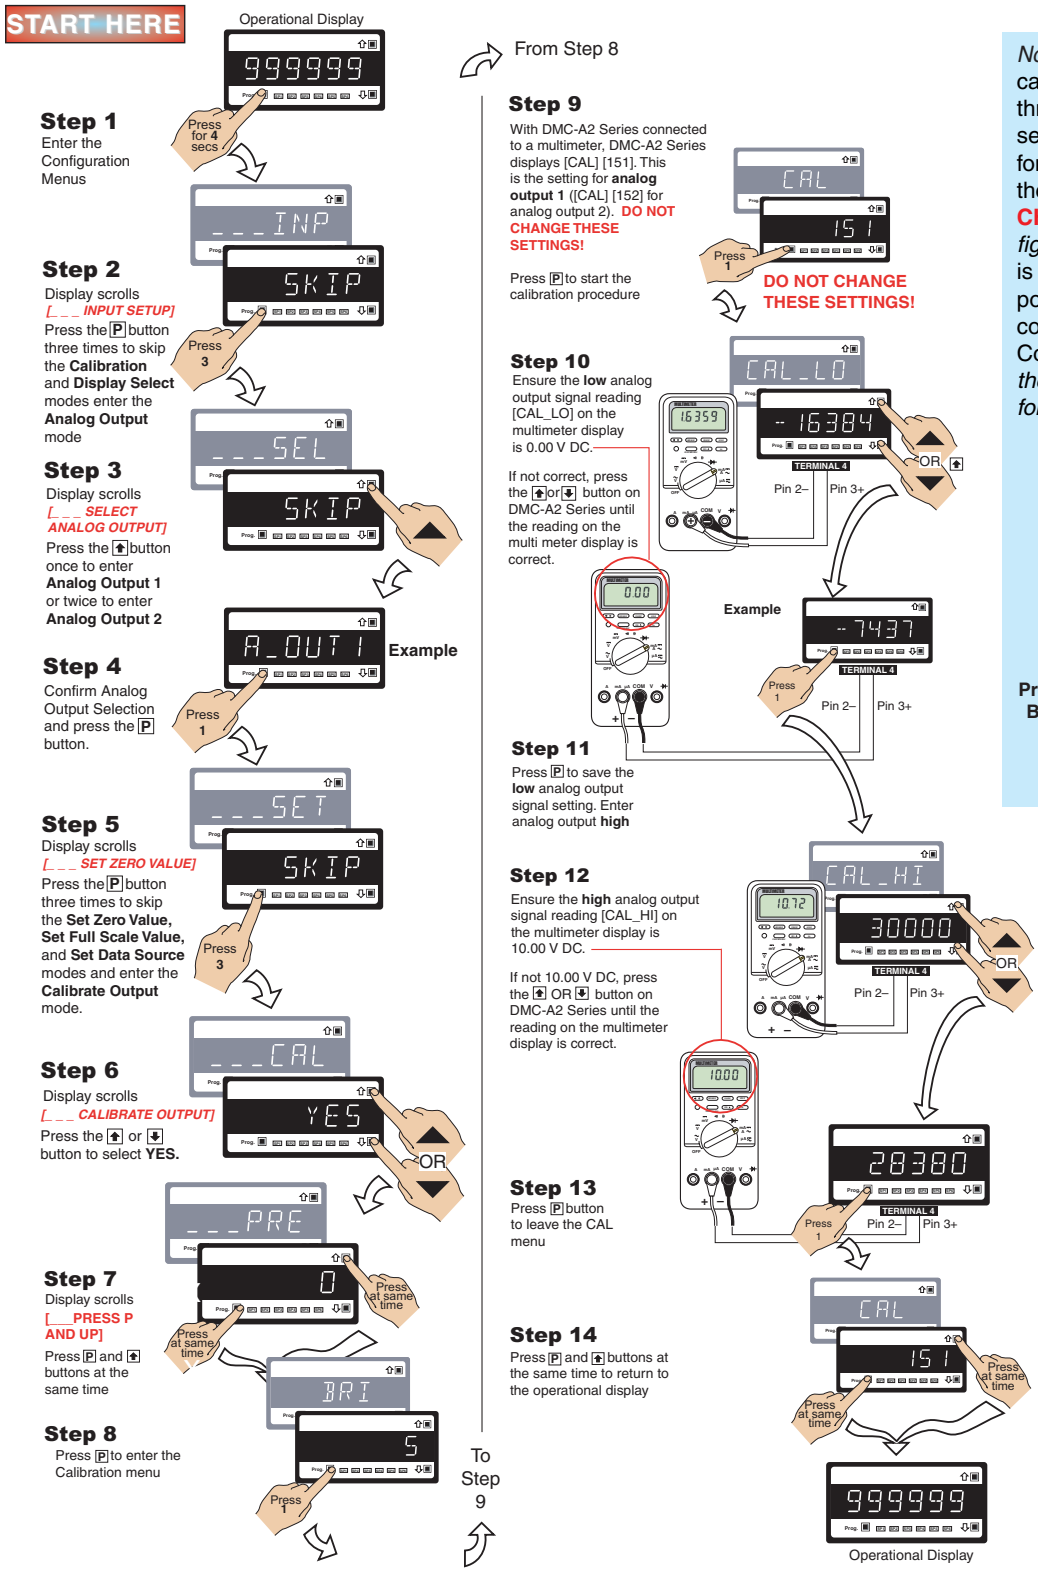
START HERE
Operational Display
999999
Step 1
Enter the Configuration Menus
Press for 4 secs
___INP
Step 2
Display scrolls [___INPUT SETUP]
Press the P button three times to skip the Calibration and Display Select modes enter the Analog Output mode
Press 3
SKIP
___SEL
Step 3
Display scrolls [___SELECT ANALOG OUTPUT]
Press the button once to enter Analog Output 1 or twice to enter Analog Output 2
SKIP
A_OUT 1
Example
Step 4
Confirm Analog Output Selection and press the P button.
Press 1
___SET
Step 5
Display scrolls [___SET ZERO VALUE]
Press the P button three times to skip the Set Zero Value, Set Full Scale Value, and Set Data Source modes and enter the Calibrate Output mode.
Press 3
SKIP
___CAL
Step 6
Display scrolls [___CALIBRATE OUTPUT]
Press the or button to select YES.
YES
OR
___PRE
Step 7
Display scrolls [___PRESS P AND UP]
Press P and buttons at the same time
Press at same time
0
BRI
Step 8
Press P to enter the Calibration menu
5
Press 1
To Step 9
From Step 8
Step 9
With DMC-A2 Series connected to a multimeter, DMC-A2 Series displays [CAL] [151]. This is the setting for analog output 1 ([CAL] [152] for analog output 2). DO NOT CHANGE THESE SETTINGS!
Press P to start the calibration procedure
CAL
151
Press 1
DO NOT CHANGE THESE SETTINGS!
Step 10
Ensure the low analog output signal reading [CAL_LO] on the multimeter display is 0.00 V DC.
If not correct, press the or button on DMC-A2 Series until the reading on the multi meter display is correct.
CAL_LO
-16384
16359
TERMINAL 4
Pin 2– Pin 3+
OR
000
Example
-7437
Press 1
Step 11
Press P to save the low analog output signal setting. Enter analog output high
Step 12
Ensure the high analog output signal reading [CAL_HI] on the multimeter display is 10.00 V DC.
If not 10.00 V DC, press the OR button on DMC-A2 Series until the reading on the multimeter display is correct.
CAL_HI
30000
10.72
10.00
Step 13
Press P button to leave the CAL menu
28380
Step 14
Press P and buttons at the same time to return to the operational display
CAL
151
Press at same time
999999
Operational Display

Note: When in the analog output calibration mode, the meter uses the three right-hand side display digits to select the required calibration functions for configuration. These are known as the 1st, 2nd, and 3rd digits. **DO NOT CHANGE THESE SETTINGS!** *See figure below.* Alternately, if the meter is connected to a PC through the serial port, all calibration functions can be configured using the Meter Configuration Utility Program. *Refer to the Meter Configuration Utility Program for details.*

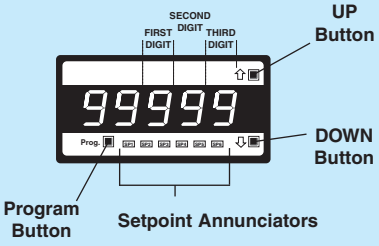

Meter Programming Digits for Calibration Mode Functions

LVDT sensors can be applied in almost all engineering applications covering civil, mechanical, petrochemical, power generation, production, aerospace, defense, and much more.

They can be used on production lines to automatically gauge products for quality control and product sorting.

In the power generation and petrochemical industries they can be used, for example, as servo position feedback on actuated equipment such as valves and dampers, or for measuring turbine casing expansion.

Submersible units can be used in marine and offshore mining applications, sensors that meet military environmental standards have been applied to defense and aerospace applications.

Following are applications that show the versatility of the DMC-A2 Series controller.

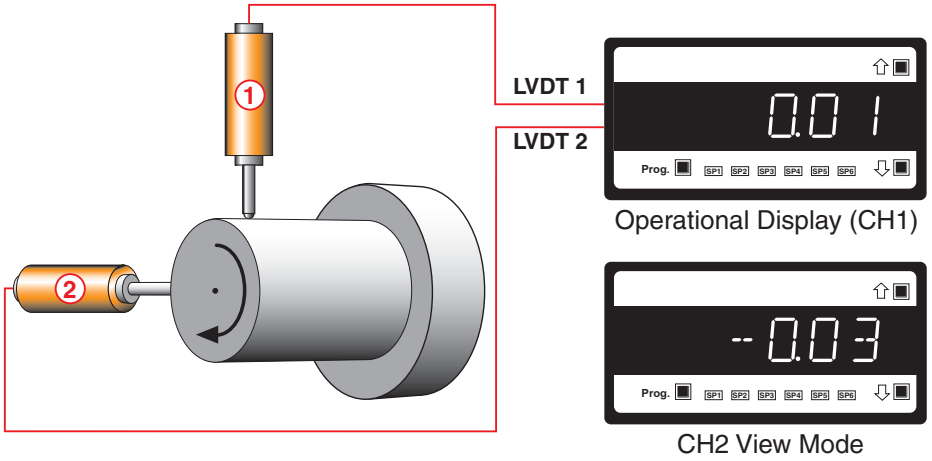

ALIGNMENT TOOL

Measured using two LVDT sensors at 90°

LVDT 1 to CH1 = Shown on Display

LVDT 2 to CH2 = Use View Mode to view CH2

SLOPE INDEXING

Measured using two parallel LVDT sensors (1 – 2)

LVDT 1 minus LVDT 2 = Displayed Result

Note:
This is an advanced function and is configured in Code 1 of the main programming mode.

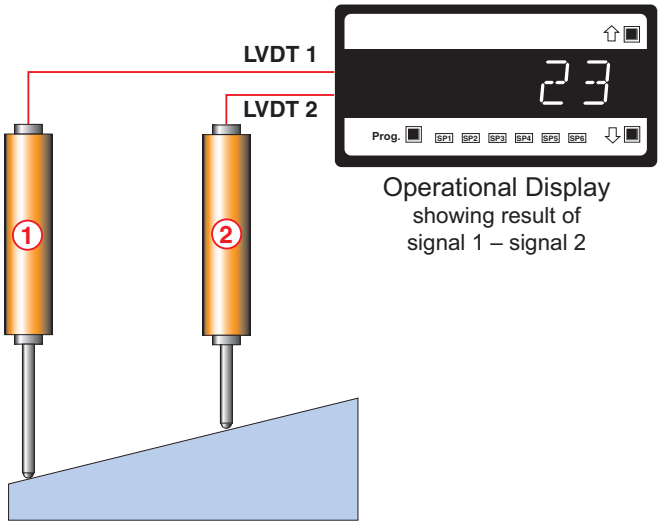

THICKNESS MONITORING

Measured using two opposed LVDT sensors (1 + 2)

LVDT 1 plus LVDT 2 = Displayed Result

Note:
This is an advanced function and is configured in Code 1 of the main programming mode.

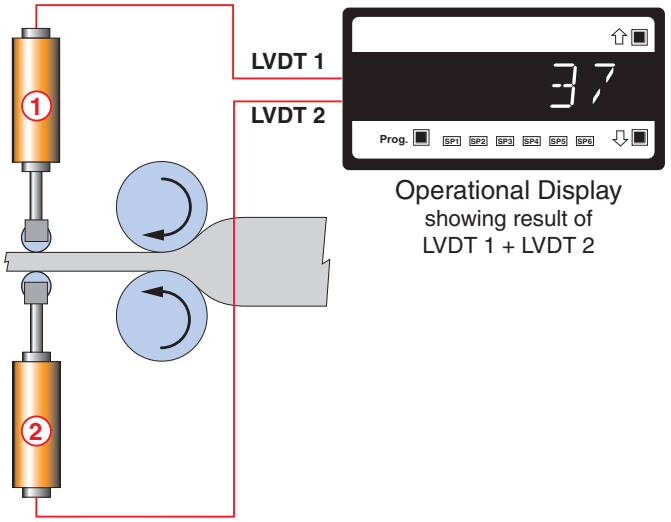

Communication Formats

ASCII Mode

The ASCII mode is a simple, isolated ASCII communication protocol using the standard ASCII character set. This mode provides external communication between the meter and a PC allowing remote programming to be carried out.

DMC-A2 Series meters use a serial communication channel to transfer data from the meter to another device. With serial communications, data is sent one bit at a time over a single communications line. The voltage is switched between a high and a low level at a predetermined transmission speed (baud rate) using ASCII encoding. Each ASCII character is transmitted individually as a byte of information (eight bits) with a variable idle period between characters. The idle period is the time between the receiving device receiving the stop bit of the last byte sent and the start bit of the next byte. The receiving device (for example a PC) reads the voltage levels at the same interval and then translates the switched levels back to an ASCII character. The voltage levels depend on the interface standard being used.

Table 1 lists the voltage level conventions used for RS-232. The voltage levels listed are at the receiver.

See Table 2 for a list of the most commonly accessed ASCII mode registers.

Each ASCII character is 'framed' with:

- A start bit.
- An optional error detection parity bit.
- And one or more ending stop bits.

For communication to take place, the data format and baud rate (transmission speed) must match that of the other equipment in the communication circuit. Figure 5 shows the character frame formats used by the meter.

Table 1 Interface Voltage Level Conventions

Logic	Interface State	RS-232
1	Mark (idle)	TXD, RXD: -3 to -15 V
0	Space (active)	TXD, RXD: +3 to +15 V

Table 2 Common ASCII Registers (32-bit Registers)

ASCII Reg. #	Function	Modbus Reg. #
1	Alarm Status	**40000**
2	Display Register	**40513**
3	Processed Data Result	**40515**
4	Processed Data – Channel 1	**40517**
5	Processed Data – Channel 2	**40519**
39	Processed Data – Channel 3	**40521**
40	Processed Data – Channel 4	**40523**
6	Setpoint 1	**40535**
7	Setpoint 2	**40537**
8	Setpoint 3	**40539**
9	Setpoint 4	**40541**
10	Setpoint 5	**40543**
11	Setpoint 6	**40545**
12	Peak	**40525**
13	Valley	**40527**
14	Tare	**40533**
15	*Reserved for Texmate Use*	–
16	Total 1	**40529**
17	Total 2	**40531**

Character Frame Formats

Start Bit and Data Bits

Data transmission always begins with the start bit. The start bit signals the receiving device to prepare to receive data. One bit period later, the least significant bit of the ASCII encoded character is transmitted, followed by the remaining data bits. The receiving device then reads each bit position as they are transmitted and, since the sending and receiving devices operate at the same transmission speed (baud rate), the data is read without timing errors.

Parity Bit

To prevent errors in communication, the sum of data bits in each character (byte) must be the same: either an odd amount or an even amount. The parity bit is used to maintain this similarity for all characters throughout the transmission.

It is necessary for the parity protocol of the sending and receiving devices to be set before transmission. There are three options for the parity bit, it can be set to either:

- None – which means there is no parity.
- Odd – which means the sum of bits in each byte is odd.
- Even – which means the sum of bits in each byte is even.

After the start and data bits of the byte have been sent, the parity bit is sent. The transmitter sets the parity bit to 1 or 0 making the sum of the bits of the first character odd or even, depending on the parity protocol set for the sending and receiving devices.

As each subsequent character in the transmission is sent, the transmitter sets the parity bit to a 1 or a 0 so that the protocol of each character is the same as the first character: odd or even.

The parity bit is used by the receiver to detect errors that may occur to an odd number of bits in the transmission. However, a single parity bit cannot detect errors that may occur to an even number of bits. Given this limitation, the parity bit is often

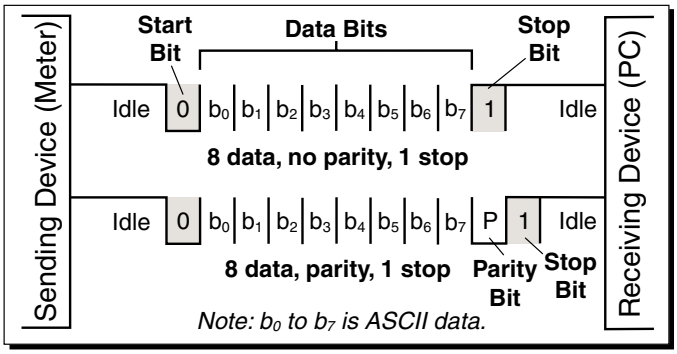

Figure 5 – Character Frame Formats

ignored by the receiving device. The user sets the parity bit of incoming data and sets the parity bit to odd, even or none (mark parity) for outgoing data.

The parity bit is set in the Calibration Mode.

Stop Bit

The stop bit is the last character to be transmitted. The stop bit provides a single bit period pause to allow the receiver to prepare to re-synchronize to the start of a new transmission (start bit of next byte). The receiver then continuously looks for the occurrence of the start bit.

Note: DMC-A2 Series meters use only one stop bit.

Command Response Time

The meter uses half-duplex operation to send and receive data. This means that it can only send or receive data at any given time. It cannot do both simultaneously. The meter ignores commands while transmitting data, using RXD as a busy signal.

When the meter receives commands and data, after the first command string has been received, timing restrictions are imposed on subsequent commands. This allows enough time for the meter to process the command and prepare for the next command.

See Figure 6. At the start of the time interval t_1, the sending device (PC) prints or writes the string to the com port, thus initiating a transmission. During t_1 the command characters are under transmission and at the end of this period the command terminating character is received by the meter. The time duration of time interval t_1 is dependent on the number of characters and baud rate of the channel:

$$t_1 = (10 * \#\ of\ characters) / baud\ rate$$

At the start of time interval t_2, the meter starts to interpret the command, and when complete performs the command function.

After receiving a valid command string, the meter always indicates to the sending device when it is ready to accept a new command. After a read command, the meter responds with the requested data followed by a carriage return (øDH) and a line feed (øAH) character. After receiving a write command, the meter executes the write command and then responds with a carriage return/line feed.

The sending device should wait for the carriage return/line feed characters before sending the next command to the meter.

If the meter is to reply with data, time interval t_2 is controlled by using the command terminating character: **$** or *. The **$** terminating character results in a response time window of 50 ms minimum and 100 ms maximum. This allows enough time to release the sending driver on the RS-485 bus. Terminating the command line with the * symbol, results in a response time window (t_2) of 2 ms minimum and 50 ms maximum. The faster response time of this terminating character requires that sending drivers release within 2 ms after the terminating character is received.

At the start of time interval t_3, the meter responds with the first character of the reply. As with t_1, the time duration of t_3 is dependent on the number of characters and baud rate of the channel:

$$t_3 = (10 * \#\ of\ characters) / baud\ rate$$

At the end of t_3 the meter is ready to receive the next command.

The maximum throughput of the meter is limited to the sum of the times: t_1, t_2, t_3.

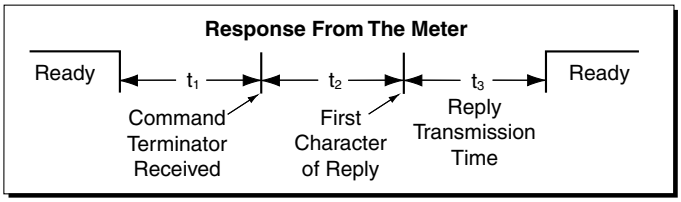

Figure 6 – Timing Diagram

ASCII Serial Mode Read/ Write Information

ASCII Command Character Descriptions

Table 3 describes the functions of the command string characters. Table 4 shows examples of how the command string is constructed.

Command String Construction

When sending commands to the meter using a Terminal emulation program, a string containing at least one command character must be constructed. A command string consists of the following characters and must be constructed in the order shown:

1) A start character.
2) The meter (node) address (optional).
3) The read/write command.
4) The register address.
5) A separator character.
6) The data value.
7) The message terminator.

Figure 7 shows an example of a command string.

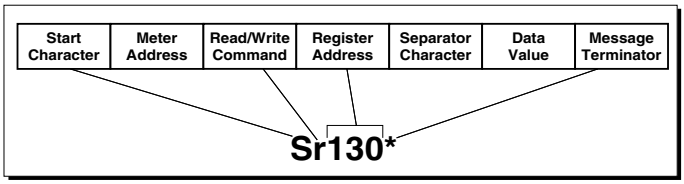

Figure 7 – Example of a Command String

Table 3	Command Character Descriptions	
Command	**Description**	**Function**
S or **s**	Start Character	The **start character** must be the first character in the string.
0 to **255**	Meter (Node) Address Specifier	The next character assigns an address to a specific meter. If the character following the start character is not an ASCII number, then address 0 is assumed. All meters respond to address 0.
R or **r** for read **W** or **w** for write	Read/Write Command	The next character is the **read/write command** character. The **read command** reads a register from the meter. The **write command** writes to a register of the meter. Using any other character for the read or write character will abort the operation
ASCII number **1** to **65535**	Register Address	The **register address** for the read/write operation is specified next. It can either be an ASCII number from 1 to 65535 or register 1 to 18 can be accessed by entering an ASCII letter from A to R (not case sensitive). If the address character is omitted in a read command, the meter will always respond with the data value currently on the display. The register address must be specified for a write command.
Space or ","	Separator Character	After the register address in a write command, the next character must be something other than an ASCII number. This is used to separate the register address from the data value. It can be a **space** or a "**,**" or any other character except a "**$**" or a "*****".
Range between **–9999999** to **9999999**	Data Value	After the separator character, the **data value** is sent. It must be an ASCII number in the range of **–9999999** to **9999999** (Fixed Point Register). Note: The range will vary depending on which register is accessed.
$ or *****	Message Terminator	The last character in the message is the **message terminator**. This must be either **$** or *****. If the **$** is used as a terminator, a minimum delay of 50 ms is inserted before a reply is sent. If the ***** is used as a terminator, a minimum delay of 2 ms is inserted before a reply is sent. The **$** and ***** characters must not appear anywhere else in the message string.
CR/LF	Meter Response	After the meter has completed a read or write instruction, it responds by sending a **carriege return/ line feed** back to the host. If the instruction was a read command, the CR/LF follows the last character in the ASCII string. If it was a write command, the CR/LF is the only response sent back to the host. The host must wait for this before sending any further commands to the meter. A read or write to a not valid or non-existant register, produces a null character followed by a CR/LF.

Table 4	ASCII Command String Examples
Command String	**Command String Description**
SR$	Read display value, 50 ms delay, all meters respond.
s15r$	Read display value, 50 ms delay, meter address 15 responds.
SR12*	Read peak value, 2 ms delay, all meters respond.
Sr130*	Read Code 1 setting, 2 ms delay, all meters respond.
s2w2 -10000$	Write 10 000 to the display register of meter address 2, 50 ms delay.
SWT Chan_1$	Write ASCII text string **Chan_1** to text register T, 50 ms.
S10w148,7*	Change brightness to 7 on meter address 10, 2 ms delay.

Multiple Write

The multiple write feature of the DMC-A2 meter allows multiple registers to be written to in a single ASCII command string. It is similar to a normal write command but with the following differences:

- After the first data value, a separator character is inserted instead of the message terminator. The next register address is then specified, followed by another separator character and the next data value. This procedure is repeated for each new register. The message terminator is added after the last data value in the string.
- Any number of registers can be written to using the multiple write feature, as long as the total length of the command string does not exceed 73 ASCII characters, including spaces and the message terminator.

Figure 8 shows two examples of the multiple write command.

Note: The multiple write feature cannot be used with special ASCII registers (H to X).

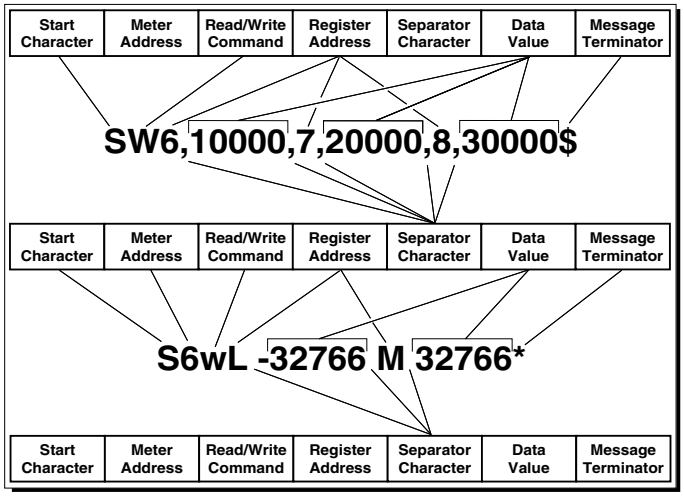

Figure 8 – Examples of Multiple Write Command

Special ASCII Registers

DMC-A2 Series meters can have 6-digit displays using 15-segment display LEDs. Table 5 shows which characters can be used with a 15-segment display LED along with the associated ASCII value.

Registers H to W – Display Customizing

Text can be customized on the following text displays to suit a particular application:

- Register H – Text display for peak.
- Register I – Text display for valley.
- Register J – Text display for total.
- Register K – Text display for sub-total.
- Register L – Text display for setpoint 1.
- Register M – Text display for setpoint 2.
- Register N – Text display for setpoint 3.
- Register O – Text display for setpoint 4.
- Register P – Text display for setpoint 5.
- Register Q – Text display for setpoint 6.
- Register R – Text display for overrange.
- Register S – Text display for underrange.
- Register T – Text display for channel 1.
- Register U – Text display for channel 2.
- Register V – Text display for channel 3.
- Register W – Text display for channel 4.

The text string displayed by the meter can be 6 ASCII characters long.

If a text string is read in the usual manner. For example, **SRT$**, where:

- **S** for the start character.
- **R** for the read character.
- **T** for the text display for Channel 1.
- **$** for the message terminator.

The meter responds by displaying the stored string: **CH_1**.

To customize the text string of the text display for Channel 1, from **CH_1** to **Hello**, issue the following command:

SWT Hello$

When the text display for Channel 1 is displayed on the meter, instead of **CH_1** being displayed, **Hello** is now displayed.

Register X – Print String

The print mode allows the meter to print data from any meter register directly to a serial printer, or to a PC where it can be imported into a spreadsheet.

Register X is a special register that allows you to specify the text and data stored in specific registers to be printed out when a print command is issued by the meter while in the print mode. Through the serial port, register X can be either written to or read from using a terminal program on a PC.

Writing To Register X

Writing to register X tells the meter to print the data stored in one or more of the meter's registers when the print command is issued. To get the meter to print, the printer must be connected to the meter through the serial port and the meter must be programmed to [XX3] in Code 3. The data to be printed depends on how the meter has been programmed, for example, to display a flow rate and total.

The total length of a write string can be up to 30 ASCII characters long

See Printing Restrictions below.

Reading From Register X

Reading from register X allows you to check your settings prior to removing the PC from the serial port and connecting to a printer. Register X can be read in the normal manner (i.e. SRX$).

Example of Writing To Register X

The following example shows a write to register X with the meter set to display flow rate and total flow of channel 1 in Code 2.

swx Rate = ~2 (add carriage return and line feed)

Total = ~16$

The above write to register X means the following:

swx: Start writing to register X.

Rate =: Tells the meter to print the word Rate =.

~2: Tells the meter to print the current flow rate (display data), held in register 2, after the word Rate =.

Total =: Tells the meter to print the word Total =.

~16: Tells the meter to print the current total flow (stored data), held in register 16, after the word Flow =.

The printer would then print, for example, the following:

Rate = 2000

Total = 25000

This means that the current flow rate is 2000 and the total flow at this point is 25000.

Example of Reading From Register X

Having written the above example to the meter, to check the contents of register X using the terminal program through the PC, type the following:

srx$

The following is shown on the PC screen:

Rate = ~2

Total = ~16$

Table 5 ASCII Characters for 15-Segment Display

Character	Register Control value (Decimal)	Character	Register Control value (Decimal)
Space	32	**@**	64
!	33	**A**	65
"	34	**b**	66
#	35	**C**	67
$	36	**d**	68
%	37	**E**	69
&	38	**F**	70
'	39	**G**	71
(	40	**H**	72
)	41	**i**	73
*****	42	**J**	74
+	43	**k**	75
,	44	**L**	76
-	45	**M**	77
.	46	**n**	78
/	47	**o**	79
0	48	**P**	80
1	49	**q**	81
2	50	**r**	82
3	51	**S**	83
4	52	**t**	84
5	53	**u**	85
6	54	**V**	86
7	55	**W**	87
8	56	**X**	88
9	57	**Y**	89
:	58 (displayed as decimal point)	**Z**	90
;	59	**[**	91 (same as "C")
<	60	****	92
=	61	**]**	93
>	62	**^**	94
?	63	**_**	95

Printing Restrictions

When printing, any alphanumeric ASCII character can be used within the following restrictions:

- The **$** and ***** characters are reserved for the terminating character at the end of the string and cannot be used as part of the text string.
- The total string length must be no greater than 30 bytes long. This includes spaces, tabs, carriage returns, line feeds, and the terminating character. There must be a separator space between the register address X and the start of the string. This separator space does not have to be included in text string length calculations.
- Any number following a ~ character will be interpreted as a register address. During a printout the register's current value will be printed out in this position.
- The ASCII character **** is treated as a special character in the print string. When a **** is encountered, a ***** is printed in its place (***** is reserved as a terminating character and normally can not appear anywhere in the text string). This allows the print output of one meter to be connected to another meter that is operating in the ASCII mode.

For example, if the print string reads:

swx sw3 ~5\ sw4 ~12\ sw6 ~2\$

The printer prints the following:

sw3 (current register value)***** **sw4** (current register value)*****

sw6 (current register value)*****

Note: As a new line is usually represented by a carriage return and a line feed, two bytes should be added for each new line in text string length calculations.

Up to seven different registers can be specified in one text string, provided that the total string length is no greater than 30 bytes long and the total length of the resulting printout is less than 100 bytes long (including time stamp if selected).

For example, the following tab delimited output could be specified to input display data, processed result, processed channel 1, processed channel 2, peak, valley, and total, directly into a spreadsheet:

swx~2(tab)~3(tab)~4(tab)~5(tab)~12(tab)~13(tab)~p$

When calculating the length of the printout, an allowance of 7 bytes for each register address should be used, plus any extra text or separating characters such as tabs or spaces.

Serial Output Module Settings

Setting the 1st digit to 2 and the 2nd digit to 0 [CAL] [20X] accesses the serial communications output module properties: baud rate, parity, transmit time delay, and address settings.

Baud Rate

The baud rate range is selectable from 600 to 38400 baud. The default baud rate is 9600.

- 600.
- 1200.
- 2400.
- 4800.
- 9600.
- 19200.
- 38400.

Parity

The default parity setting is [oFF]. Parity [odd] or [EVEn] can also be selected.

Transmit Time Delay

The transmit time delay restricts the meter from transmitting a reply to a slow or busy master device (PC, PLC, etc.) by providing time delays of 2, 20, 50, or 100 milliseconds for all serial modes except ASCII (Code 3 set to XX0).

The ASCII Mode uses message terminating characters:

- ***** = 2 milliseconds.
- **$** = 50 milliseconds.

Address

The default address setting is 1, but can be set to anywhere between 1 and 255.

Serial Communications Hardware Pinouts & Interconnections

RS-232 Interconnections

Hardware Requirements

The following hardware is required to set the meter up for simple RS-232 communications (see Figure 9):

- DMC-A2 Series meter with RS-232 serial output module option installed.
- RJ-11 to DB-25 interface connector (and possibly a DB-25 to DB-9 interface connector depending on PC serial port).
- Standard 4-wire cable with male RJ-11 connectors (see Figure 10 and 11, and Tables 6 and 7 for a wiring diagram and pin descriptions).
- PC running a terminal program.

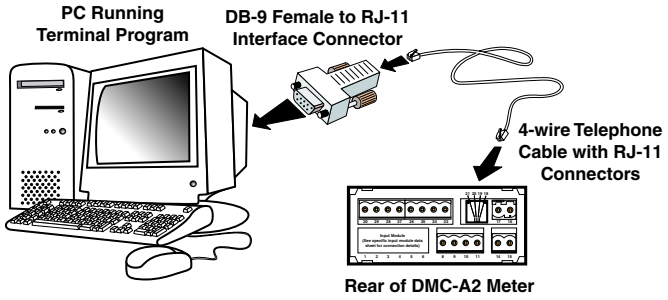

Figure 9 – RS-232 Hardware Connections

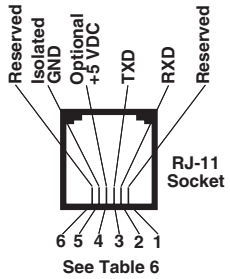

Figure 10 – RJ-11 Connections

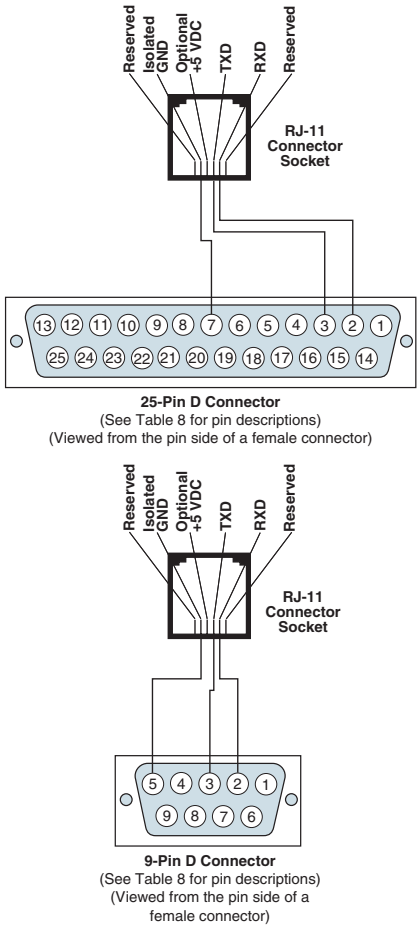

Figure 11 – RJ-11 to 9-pin and 25-pin D Connectors

Table 6 lists the pinouts for an RS-232 to RJ-11 socket configuration.

Table 6	Serial Communication Pinouts (RJ-11 Socket)
TERMINAL PINS	**RS-232**
1	Reserved for future use
2	RXD. Received Serial
3	TXD. Transmitted Serial
4	Optional +5 VDC to power external converters (jumper on RS-232 or RS-485 boards must be soldered)
5	Isolated Ground
6	Reserved for future use

Table 7 lists the pinouts for an RS-232 to 9-pin or 25-pin D connector.

Table 7	RS-232 to 25-Pin & 9-Pin D Connectors	
25-Pin	**Pin Name**	**9-Pin**
1	Frame Ground	**-**
2	Receive Data	**3**
3	Transmit Data	**2**
4	Request to Send	**7**
5	Clear to Send	**8**
6	Data Set Ready	**6**
7	Signal Ground	**5**
8	Data Carrier Detect	**1**
9	Reserved	**-**
10	Reserved	**-**
11	Unassigned	**-**
12	Sec. Carrier Detect	**-**
13	Sec. Carrier Send	**-**
14	Sec. Transmit Data	**-**
15	Transmitter Clock	**-**
16	Sec. Receive Data	**-**
17	Receiver Clock	**-**
18	Local Loopback	**-**
19	Sec. Request to Send	**-**
20	Data Terminal Ready	**4**
21	Remote Loopback/Signal Quality Detect	
22	Ring Indicator	**9**
23	Data Rate Select	**-**
24	Transmitter Clock	**-**
25	Test Mode	**-**

Meter Functions using Serial Communications

Meter Programming via Serial Port

With a serial output module installed, the meter can be fully configured using a PC and either:

- The Meter Configuration Utility Program.
- Or a terminal emulation program such as HyperTerminal.

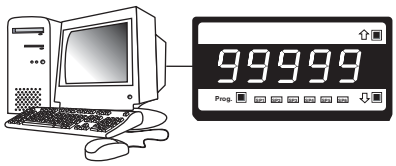

Figure 12 – Programming via Serial Port

Meter Configuration Utility Program

The **meter configuration utility program** is an intuitive, user oriented Windows based interface between the PC and the meter. In addition to all application function settings, the configuration program also provides access to the following additional features.

Configuration Data Copying

This function allows the current meter configuration settings to be copied and saved for later referral or for restoration.

Macros

A growing library of macros is available to suit a wide range of standard customer applications. Macros can be installed in the meter, via the configuration utility program and run automatically when the meter is powered up.

Terminal Emulation Program

A terminal emulation program, such as HyperTerminal, provides another interface between a PC and the meter. The terminal program allows you to read from or write to any register in the meter using an ASCII character command string.

Terminal Program Configuration & Use Procedures

The following procedures describe how to set the Microsoft HyperTerminal properties, as well as using HyperTerminal to write to and read from the meter:

STEP A Set the HyperTerminal Program Properties

1) Start the Microsoft HyperTerminal program on the PC.

2) On the **File** menu, click **Properties**.

   The **New Connection Properties** dialog box opens.

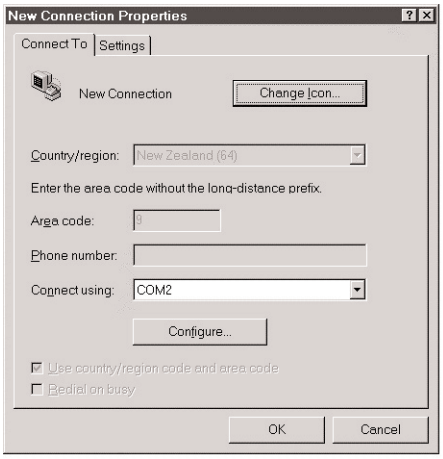

3) In the **Connect To** dialog click the arrow on the **Connect using** window and click a COM port (usually COM2).

4) Click the **Configure** button.

   The **COM2 Properties** dialog opens.

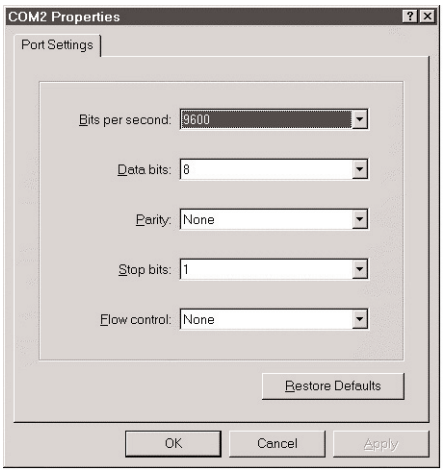

5) In the **Port Settings** dialog click the arrow on the **Bits per second** window and click 9600.

6) Click the arrow on the **Data bits** window and click **8**.

7) Click the arrow on the **Parity** window and click **None**.

8) Click the arrow on the **Stop bits** window and click **1**.

9) Click the arrow on the **Flow control** window and click **None**.

10) Click OK.

The **HyperTerminal Properties** dialog appears.

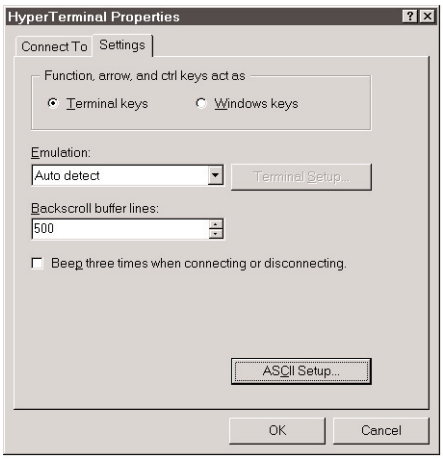

11) Click the **Settings** tab.

12) In the **Emulation** list box, click **Auto detect**.

The other settings are not relevant to this procedure and can be left as they are.

13) Click on the **ASCII Setup** button.

The **ASCII Setup** dialog opens.

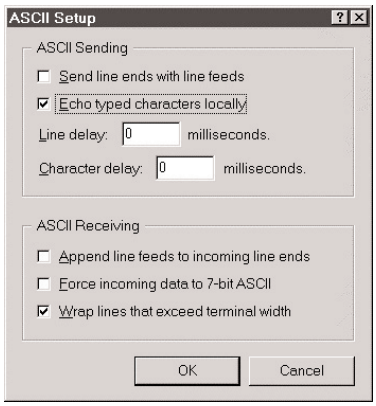

14) In the **ASCII Sending** group box, click the **Echo typed characters locally** check box.

The other settings are not relevant to this procedure and can be left as they are.

15) In the ASCII receiving group box, make sure the **Append line feeds to incoming line ends** check box is **not** checked.

16) Click OK.

The **ASCII Setup** dialog closes.

17) Click OK on the **New Connection Properties** dialog.

The **New Connection Properties** dialog closes.

STEP B Check Communications Between the Meter and the PC

1) Type the following in the terminal program: **SR***

The current meter reading is displayed on the PC screen.

STEP C Configure the Print String by Writing to Register X

1) Set the print string by selecting the register data to be downloaded by writing to register X. For example, to set the print string to download the current display value (from display register 2) and peak value (from peak register 12), type the following:

SWX ~2 ~12* (the spaces must be included).

This means that the data from the meter will display on the PC screen when the PRINT trigger is activated.

STEP D Set the Meter to the PRINT Mode

1) Set Code 3 to [XX3] in the meter's main programming mode.

This allows the meter to send the measurement data to the PC.

STEP E Download the Data from the Meter to the PC

1) Type the following in the terminal program: **P**

The P requests the meter to download the configured print string.

STEP F Capture the Meter Measurement Data on the PC

1) On the **Transfer** menu, click **Capture Text**.

The **Capture Text** dialog opens.

2) In the **File** window, type the destination for the capture text file, or click the **Browse** button and select the destination.

3) Name the file with **.txt** file extension, or leave it as CAPTURE.TXT.

4) Click the **Start** button.

   This opens the file.

5) Type the following in the terminal program: **SR727***

   The data saves to a text file in the destination you selected. It can be opened and printed, or loaded into a word processing or spreadsheet program for further processing.

6) When the download is complete, on the **Transfer** menu, click the **Capture Text** menu, and then click **Stop**.

7) When the data logging operation is complete, exit the HyperTerminal program.

STEP G To Open the Captured Text in Microsoft Excel

1) Open Microsoft Excel.

2) Select **Open** in the **File** menu.

   The **Open** dialog opens.

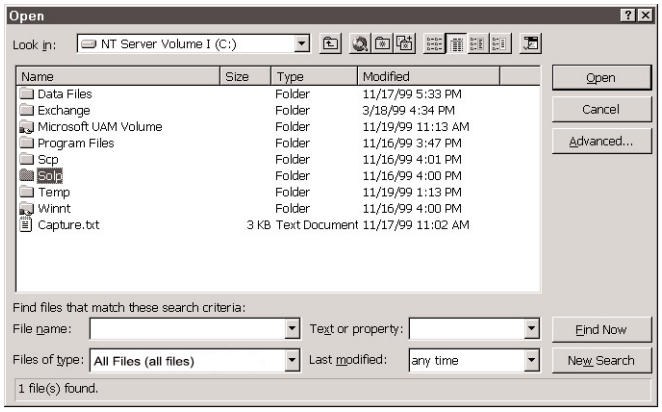
Open
Look in: NT Server Volume I (C:)
Name Size Type Modified
Data Files Folder 11/17/99 5:33 PM
Exchange Folder 3/18/99 4:34 PM
Microsoft UAM Volume Folder 11/19/99 11:13 AM
Program Files Folder 11/16/99 3:47 PM
Scp Folder 11/16/99 4:01 PM
Solr Folder 11/16/99 4:00 PM
Temp Folder 11/19/99 1:13 PM
Winnt Folder 11/16/99 4:00 PM
Capture.txt 3 KB Text Document 11/17/99 11:02 AM
Open
Cancel
Advanced...
Find files that match these search criteria:
File name:
Text or property:
Find Now
Files of type: All Files (all files)
Last modified: any time
New Search
1 file(s) found.

*Note: When loading the text file into a spreadsheet like MS Excel, it should be opened as **a space delimited file**.*

3) In the **Open** dialog, click on the arrow in the **Files of type** window and select the **All Files (all files)** file type.

4) Find your captured text file and click the **Open** button.

   The **Text Import Wizard – Step 1 of 3** dialog opens.

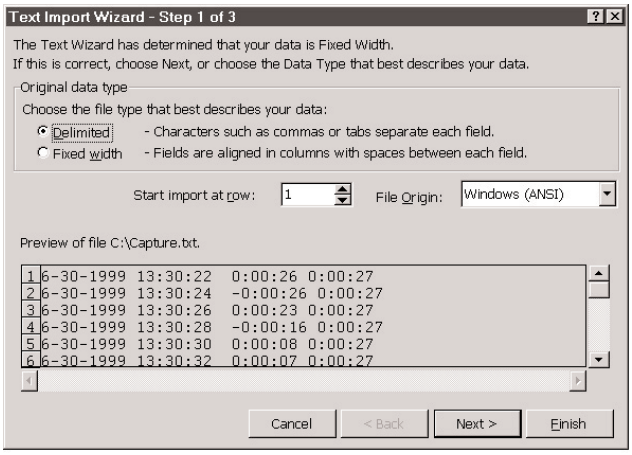
Text Import Wizard - Step 1 of 3
The Text Wizard has determined that your data is Fixed Width.
If this is correct, choose Next, or choose the Data Type that best describes your data.
Original data type
Choose the file type that best describes your data:
Delimited - Characters such as commas or tabs separate each field.
Fixed width - Fields are aligned in columns with spaces between each field.
Start import at row: 1
File Origin: Windows (ANSI)
Preview of file C:\Capture.txt.
1 6-30-1999 13:30:22 0:00:26 0:00:27
2 6-30-1999 13:30:24 -0:00:26 0:00:27
3 6-30-1999 13:30:26 0:00:23 0:00:27
4 6-30-1999 13:30:28 -0:00:16 0:00:27
5 6-30-1999 13:30:30 0:00:08 0:00:27
6 6-30-1999 13:30:32 0:00:07 0:00:27
Cancel
< Back
Next >
Finish

5) Click the **Delimited** radio button in the **Original data type** section.

6) Select the row you wish to start from in the **Start import at row** window.

7) Click the **Next** button.

   The **Text Import Wizard – Step 2 of 3** dialog opens.

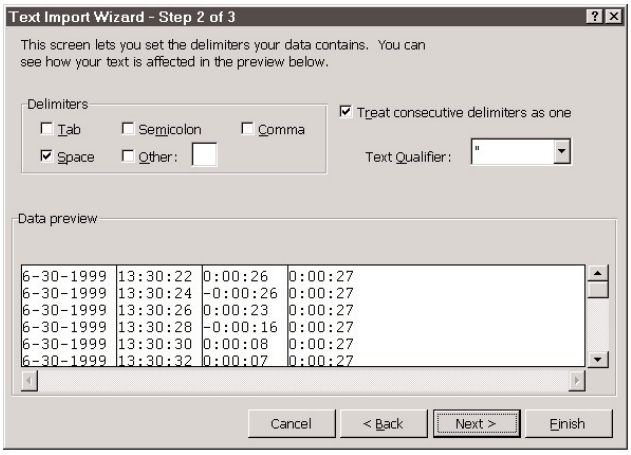

8) Check the **Space** check box in the **Delimiters** section.

9) Check the **Treat consecutive delimiters as one** check box.

10) Click the **Finish** button.

Excel will import your data and display it in four columns:

Column A: Date.

Column B: Time.

Column C: Register #2 – Rate.

Column D: Register #12 – Total.

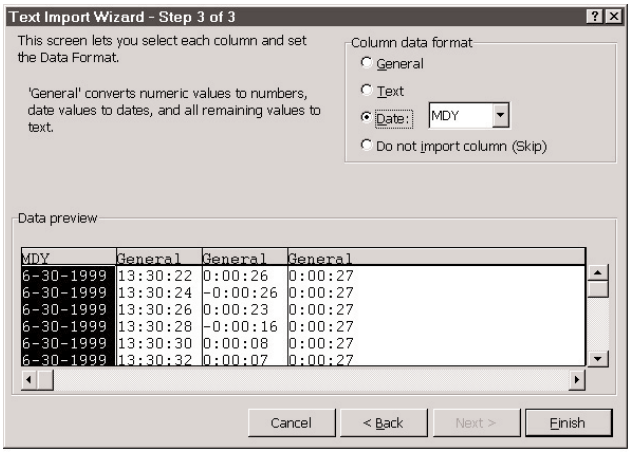
Text Import Wizard - Step 3 of 3
This screen lets you select each column and set the Data Format.
'General' converts numeric values to numbers, date values to dates, and all remaining values to text.
Column data format
General
Text
Date:
MDY
Do not import column (Skip)
Data preview
MDY General General General
6-30-1999 13:30:22 0:00:26 0:00:27
6-30-1999 13:30:24 -0:00:26 0:00:27
6-30-1999 13:30:26 0:00:23 0:00:27
6-30-1999 13:30:28 -0:00:16 0:00:27
6-30-1999 13:30:30 0:00:08 0:00:27
6-30-1999 13:30:32 0:00:07 0:00:27
Cancel
< Back
Next >
Finish

*Note: If you want, you can also set the format of the data in the columns in **Text Import Wizard – Step 3 of 3**.*

You can now use your text file data to compile graphs, etc.

Figure 13 is an example of a graph constructed from captured text in Microsoft Excel.

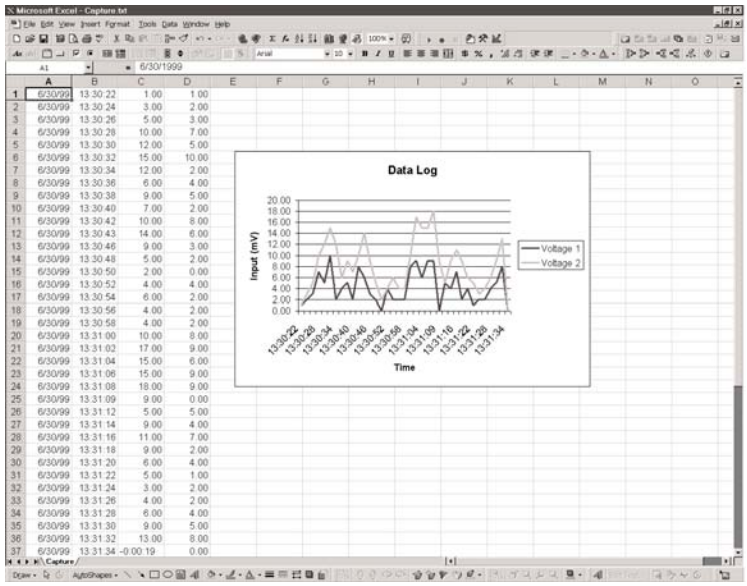

Figure 13 – Example Graph in Microsoft Excel

Frequency Range:

Excitation Frequency:

LVDT Output Rate in kHz:

Decimal Point Position:

	CH 1	CH 2

Standard Display:

Input Signal

	CH 1	CH 2
Zero:		
Span:		

Analog Output Signal Calibration

	A_OUT1	A_OUT2
CAL_LO:		
CAL_HI:		

Scale Range

Zero:		
Full Scale:		

Setpoints

	Source	Value	Activation
SP1:			
SP2:			
SP3:			
SP4:			

WARRANTY

Macro Sensors warrants that its products are free from defects in material and workmanship under normal use and service for a period of one year from date of shipment. Macro Sensors' obligations under this warranty are limited to replacement or repair, at its option, at its factory, of any of the products which shall, within the applicable period after shipment, be returned to Macro Sensors' facility, transportation charges pre-paid, and which are, after examination, disclosed to the satisfaction of Macro Sensors to be thus defective. The warranty shall not apply to any equipment which shall have been repaired or altered, except by Macro Sensors, or which shall have been subjected to misuse, negligence, or accident. In no case shall Macro Sensors' liability exceed the original purchase price. The aforementioned provisions do not extend the original warranty period of any product which has been either repaired or replaced by Macro Sensors.

USER'S RESPONSIBILITY

We are pleased to offer suggestions on the use of our various products either by way of printed matter or through direct contact with our sales/application engineering staff. However, since we have no control over the use of our products once they are shipped, NO WARRANTY WHETHER OF MERCHANTABILITY, FITNESS FOR PURPOSE, OR OTHERWISE is made beyond the repair, replacement, or refund of purchase price at the sole discretion of Macro Sensors. Users shall determine the suitability of the product for the intended application before using, and the users assume all risk and liability whatsoever in connection therewith, regardless of any of our suggestions or statements as to application or construction. In no event shall Macro Sensors' liability, in law or otherwise, be in excess of the purchase price of the product.

Macro Sensors cannot assume responsibility for any circuitry described. No circuit patent or software licenses are implied. Macro Sensors reserves the right to change circuitry, operating software, specifications, and prices without notice at any time.

For product details visit www.macrosensors.com

MACRO SENSORS™
Division Of Howard A. Schaevitz Technologies, Inc.

7300 U.S. Route 130 North Bldg. 22 • Pennsauken, NJ 08110-1541
Tel: 1-856-662-8000 • Fax: 1-856-661-8000 • Email: lvdts@macrosensors.com
Web: www.macrosensors.com

© Macro Sensors, 2006. All rights reserved.